

Mini BMW Mini Cooper - Instrument panel with sporadic malfunctioning | HELLA

Mini

BMW Mini Cooper

Model year:

11/2003 - 01/2004

Engine code: W10 B16A

All models without navigation system

Instrument panel with sporadic malfunctioning.

If a complaint is made regarding the above-mentioned fault in one of these vehicles, the possible cause is bad contact on the 12-pin multiple connector of the instrument panel.

Fault analysis is to be carried out by visibly checking the 12-pin multiple connector of the instrument panel. If the multiple connector has a transparent cover, it is to be replaced by the modified model provided by the manufacturer.

In addition, the electrical contacts / leads in the area of the instrument panel are to be visibly checked to ensure proper plugging in and correct cable laying.

Connector cover:

Spare part no.: 61.13.8.365.906