

# **Vauxhall Antara - Radio display sporadically fails | HELLA**

**Vauxhall**

**Antara**

**Model year: 2007**

**With engine: Z20DMH/Z20DM/Z24XE/Z32SE**

## **Radio display sporadically fails / engine is in emergency mode**

A faulty alternator controller may cause sporadic failures of the radio display in the above vehicles. Furthermore, the engine may enter the emergency mode.

This is often accompanied by the following error codes:

Body Control Module (BCM): B1517 (battery voltage)

Engine control unit: P0621 (alternator failure)

P0622 (alternator failure)

To remedy this, a modified alternator controller (93744610) should be installed.

Modified controller have already been used in production from the following VINs:

W0LLA63F870094862 – for engine code Z20DM/Z20DMH

W0LLA63F170151709 – for engine code Z24XE

W0LLA63F370094865 – for engine code Z32SE

Note: Delete the fault memory after the repair.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.