

Vauxhall Astra-H, Zafira-B - The ABS warning lamp lights up | HELLA

Vauxhall

Astra-H, Zafira-B

All vehicles starting from model year 2005

The ABS warning lamp lights up

Error code: C0045, C0050

If one or more of the above-mentioned errors occurs in these vehicle models, one potential cause for this may be that water has entered the plug sockets of the wheel rotational speed sensors on the rear axle. In this case, the plug sockets of the cable sets for the ABS sensors must be checked at the wheel hubs. If water has entered at the plug sockets or corrosion is already noticed, the affected plug and sensor must be replaced. Unaffected or new plug sockets should be greased with silicone grease prior to installation.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.