



Vauxhall Astra K - Noises in vehicle interior / passenger compartment

Data sheet

Manufacturer	Vauxhall
Vehicle model	Astra K
Engine	All with 1.3 / 1.6 diesel engines
Year of construction	2015 – 2018
Symptoms	Noise occurs at an engine speed of between 1500 rpm - 2500 rpm in the front area of the vehicle when the air-conditioning system is running.

Important safety note

Troubleshooting, cause and remedy

During a test drive, it was found that the noise occurred at an engine speed of between 1500 rpm - 2500 rpm. This noise was localised to the front area of the vehicle.


The cause of the noise is inadequate fastening of the brake booster vacuum line resulting from a faulty retaining clip (see picture).

Remedy: Replace the old retaining clip with a new (modified) one. OE part number: 2073033

Finally a test drive should be performed in order to run checks on the repair work

IMPORTANT

Please note that such work should only be carried out by an authorised specialist workshop and that the vehicle manufacturer's repair and maintenance instructions must be observed!

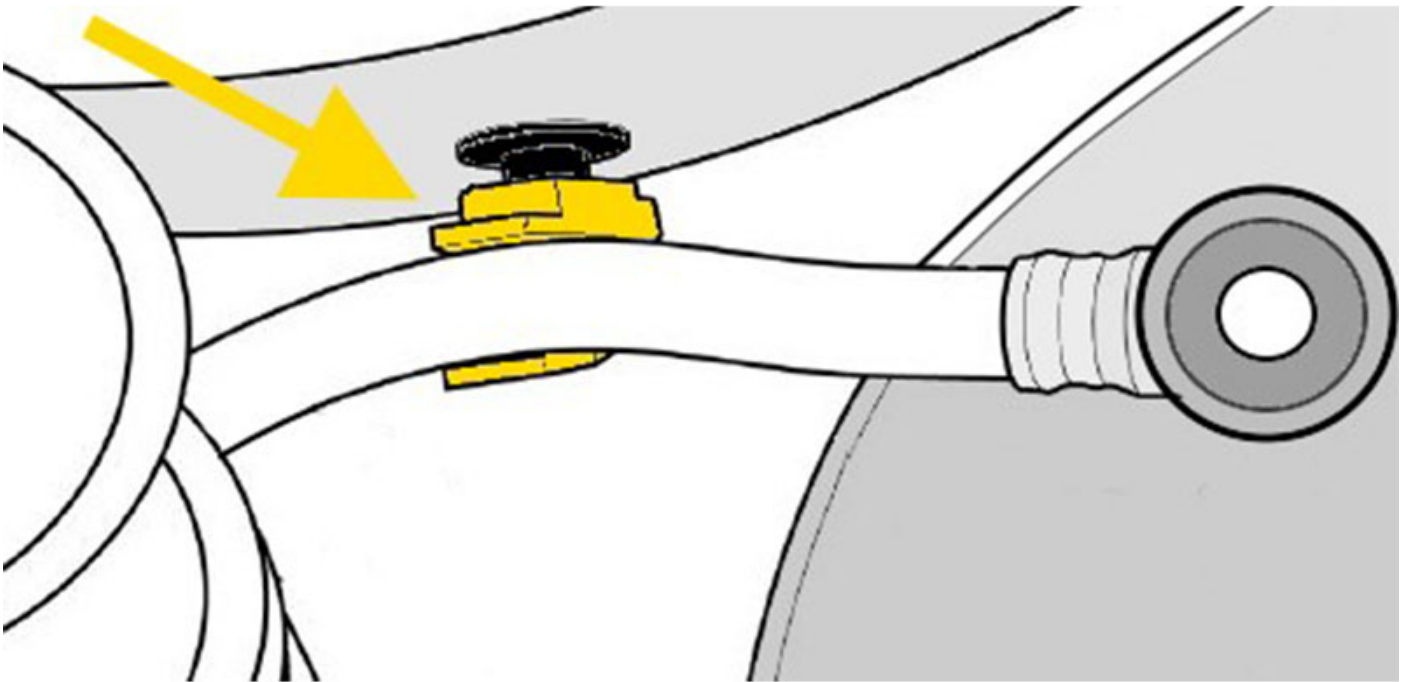

Inadequate fastening of the brake booster vacuum line caused by a faulty retaining clip.

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.