

BMW 5 Series (G30/G31)/7 Series (G11/G12) - Stop light permanently illuminated | HELLA

BMW

5 Series (G30/G31)/7 Series (G11/G12)

Model year: 05/2017

With automatic transmission

Stop light permanently illuminated

If the problem described above is determined, the cause could be a faulty ball head on the brake pedal.


If the driver accidentally raises the brake pedal, the stop-lamp switch (Item 2 on image) can be switched to permanently actuated due to a faulty ball head (Item 1 on image).

This can lead to the brake light being permanently illuminated.

Remedy:

In an authorized specialist garage check the foot lever (brake pedal) and completely replace in accordance with the manufacturer's specifications, if necessary.

The vehicle manufacturer has already addressed the issue and notified owners of all models affected. For various reasons, however, it must be assumed that not all vehicles have been checked or modified.

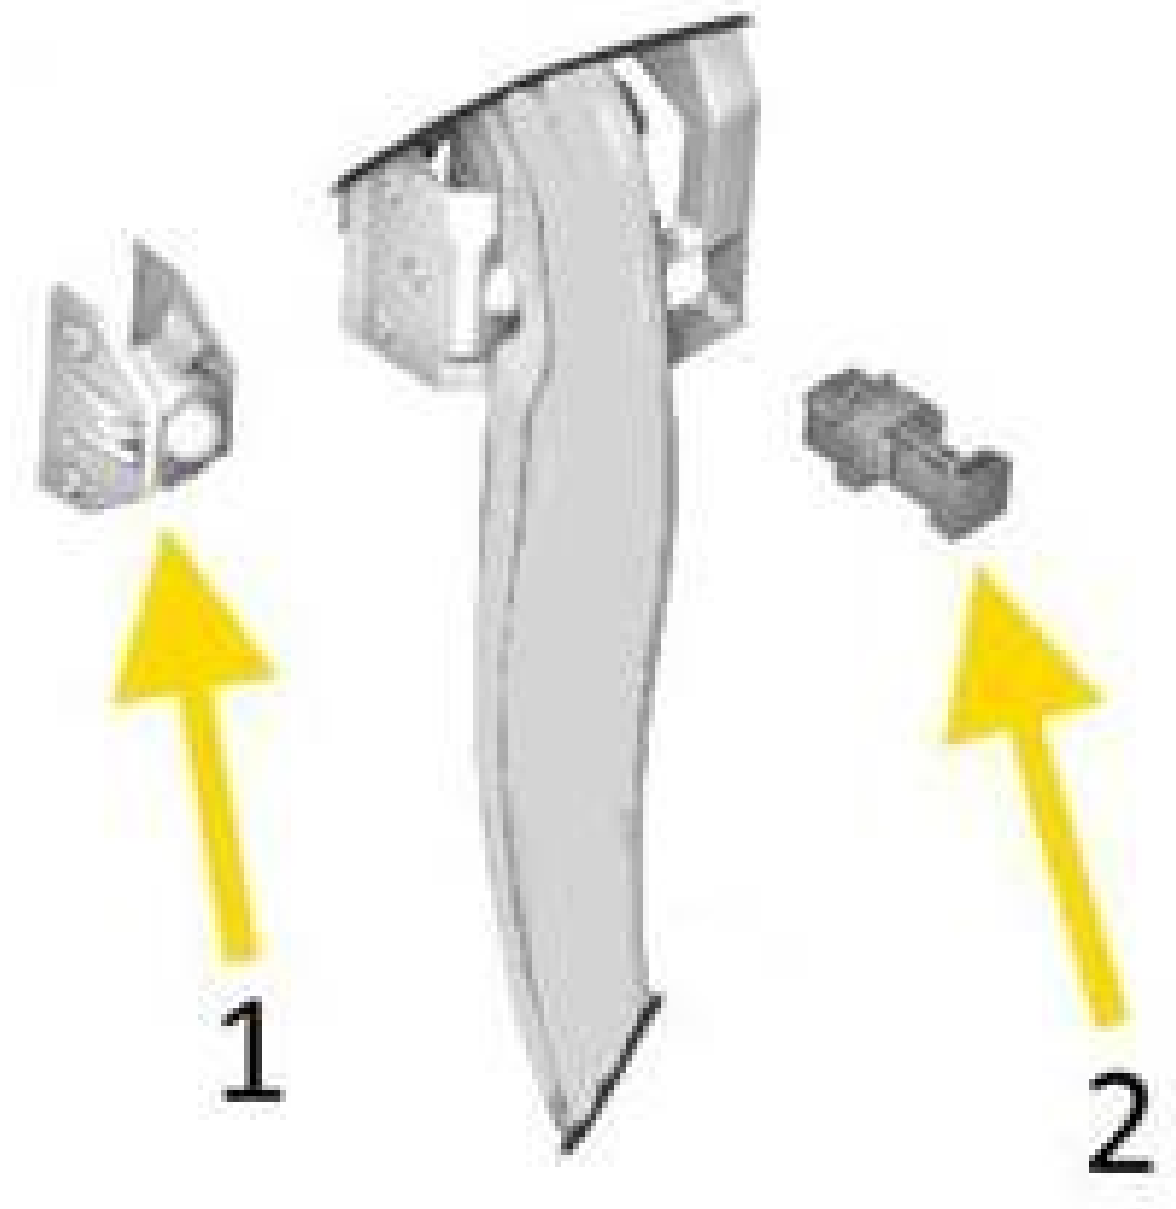

ⓘ Important safety notice

The following technical information and tips for practical use have been set up by HELLA in order to offer professional support to automotive workshops in their daily work. The information available here on this website is only to be used by appropriately trained specialist staff.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.