

# **Opel Corsa-D - Anti-lock braking system (ABS) warning light activated**

**Opel Corsa-D**

**Model year: from 2007r**

**All models**

**Anti-lock braking system (ABS) warning light activated**

**Error code C0035 or C0040 issued in the control unit**

If the error code C0035 "Front left wheel speed sensor" or C0040 "Front right wheel speed sensor" is read out from the vehicles above, a possible cause for this could be a soiled ABS sensor ring.

In this case, the following work should be carried out before renewing the sensors.

- Remove the ABS sensor
- Check the sensor ring for soiling such as grease or dirt particles through the opening in the steering knuckle
- If necessary, clean the ABS sensor ring using a cotton bud immersed in brake cleaner
- Dry the components with compressed air

Then check the sensor ring if the cleaning has attained the desired result.