



Toyota Yaris Hybrid - the hybrid system shuts down instead of going into emergency mode

Data sheet	
Manufacturer	Toyota
Vehicle model	Yaris Hybrid
Engine	1.5i 12 V HSD
Engine code	M 15A-FXE
Year of manufacture	07.2020 - 11.2020
Symptoms	Hybrid system switches off

Important safety note

Hybrid system suddenly switches off

In the case of the above-mentioned vehicle, the hybrid system, during sudden acceleration, may switch off abruptly instead of switching to emergency mode.

During excessive acceleration, there may be temporary slip in the input attenuation of the hybrid transmission.

Because of a software weakness in the hybrid control unit, this can lead to a shutting down of the hybrid system. The vehicle manufacturer has acknowledged the problem and is offering a software update as a remedy (for vehicles manufactured between 07.07.2020 and 13.11.2020). This course of action is marked "22SMD-092" and is noted in the warranty system.

If necessary, a software update can be carried out using Hella-Gutmann macsRemote Services or alternatively a pass-through-compatible diagnostic device of the mega macs series. Furthermore, registered access to the vehicle manufacturer's online portal is required. If the appropriate equipment is not available and there is no suitable access possible, please contact an authorised specialist workshop.

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.