



VW Passat - whistling noises during acceleration

Data sheet

Manufacturer	VW
Vehicle model	Passat 3G2/3G5
Engine	2.0 16 V TDI
Engine code	DFGA / CRLB
Year of manufacture	2014-2019
Symptoms	Exhaust system whistles during acceleration

Important safety information

Whistling noises from the exhaust system during acceleration

If whistling noises are detected coming from the area of the exhaust system during acceleration, a possible cause may be a defective gasket on the exhaust manifold.

In certain cases, leaks may occur on the sealing surfaces of the first and fourth cylinders as a result of the vehicle design. If no other defects are found in the exhaust system during the fault diagnosis, the seal (1) should be checked and replaced if necessary.

Recommended procedure:

- Visual inspection of the exhaust manifold to check for leaks
- Removal of the exhaust manifold and thorough cleaning of the sealing surfaces
- Installation of the exhaust manifold with new gasket and new fastening nuts

Spare parts information:

- Exhaust manifold gasket: 04L 253 039G
- Fastening nut: N 908 946 01

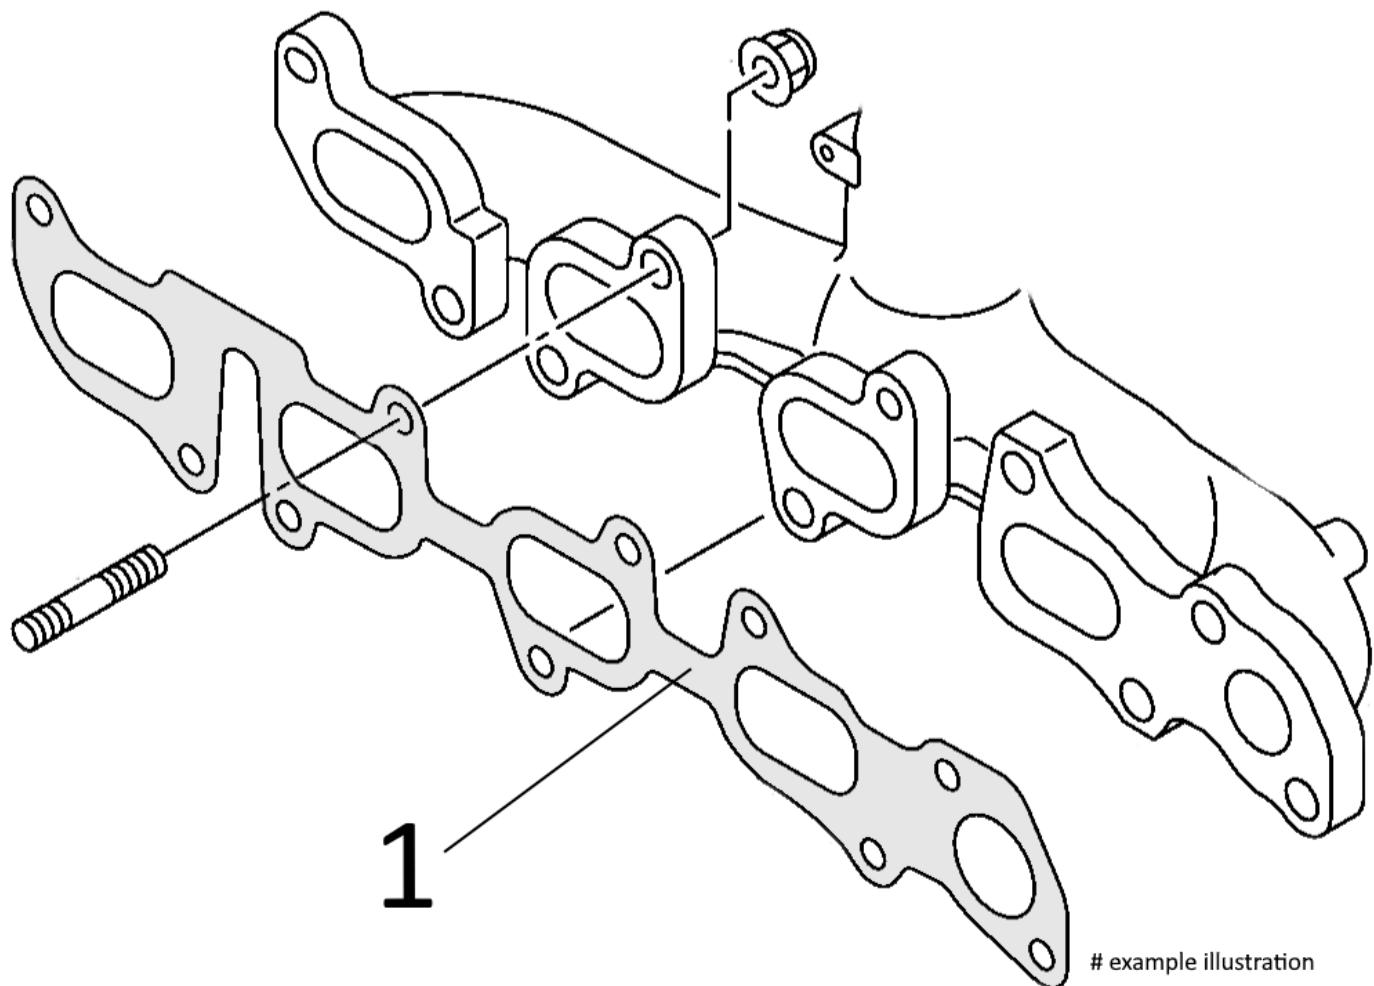


Figure 1

(i) Please note

This defect may also occur in other models with the same type of engine. The spare part numbers stated are vehicle-specific. A check using the relevant chassis number is necessary. Please follow the repair instructions from the vehicle manufacturer when carrying out such work.

Reprinting, distribution, reproduction, exploitation in any form whatsoever or disclosure of the contents of this document, even in part, is prohibited unless our express permission has been obtained in writing beforehand and the source is stated. The schematic illustrations, pictures and descriptions are provided for explanatory purposes and are only intended as a visual supplement

to the document text, so they cannot be used as the basis for installation or assembly work. All rights reserved.