



BMW E 31/ 32 | 34 | 36 **All models**

Faulty operation of the flasher system.

If there are complaints with these vehicles that the hazard warning lights switch on automatically for 10 seconds, the flashing frequency is twice the speed it should be when the indicators are switched on, the indicators light up permanently when switched on, or the flasher system fails completely, the cause could be a faulty hazard warning light flasher unit. When temperatures change quickly, condensation can build up in the hazard warning light flasher unit, leading to a short circuit in the electronics. To eliminate the problem the hazard warning light flasher unit must be replaced.

Hella part numbers for all the models listed above:

4DB 006 716-031 vehicles without towbar

4DM 009 103-011 vehicles with towbar

