

© Hella KGaA Hueck & Co., Lippstadt 14 January 2008 1-1

Citroen Saxo Model year from 1996 to 2003 All vehicles

Airbag control lamp illuminates

If there are complaints about the above-mentioned fault, the cause could be an increased resistance in the belt-tensioner multi-plug of the SRS system. These plugs are each located on the underside of the front seats. In this case, proceed as follows:

- Switch off the ignition.
- Disconnect the earth cable from the battery and wait
 10 minutes until the capacitors have discharged.
- Disconnect the multi-plug connections and remove receptacle housings and the plug-housings from the cables.
- Strip 10 mm of insulation from the ends of the cables.
- Connect the cable ends together with the aid of fully insulated insulating splices (Hella part no.: 8KW 732 579-003).
- Lay and fasten the cables correctly again.
- Connect the battery.
- Delete the fault memory.
- Check that the airbag warning lamp has gone out.



