



Citroen Saxo All models from 1996 to 2003

Interior fan without function

If there are complaints about the above-mentioned fault, the contact plate from the ignition-starter switch could be the cause. Individual contacts could be damaged there. In addition, there can be complaints that the rear window heating is not working. In this case, fuse F2 (25 A, see Fig. 1) must be checked in the fuse box / relay plate 1.

The fuse box is in the lower part of the cockpit. In addition, the voltage supply from the ignition-starter switch at the relay (see Fig. 2, pin 3) must be checked for the interior blower. On-board mains voltage must be applied here. If this is not the case, check the ignition-starter switch and the wiring to the relay and repair or replace as necessary.

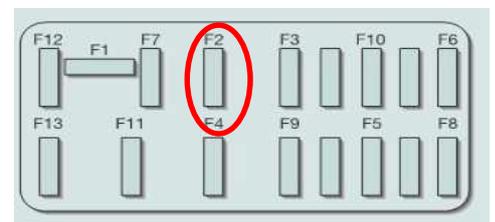


Fig. 1

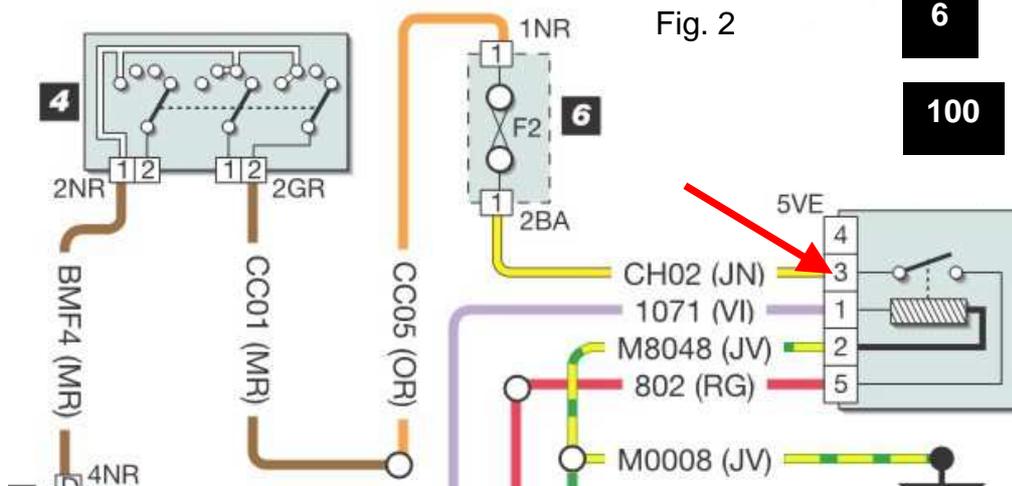


Fig. 2

- 4** Ignition-starter switch
- 6** Fuse F2
- 100** Relay, interior blower