



Daewoo Matiz (KLYA) Model year: 2000 - 2001

Problems caused by faulty wiring harness on the engine control unit

In the above-mentioned vehicles, a chafed wiring harness leading from the engine control unit to the engine compartment can be responsible for various faults. In case of complaint, please check the wiring harness beneath the EGR valve first.

At this spot, the wiring harness can come into contact with the screw of a fixing clamp which can cause chafing. If this is the case, the cable strand should be replaced and routed in such a way that contact with other components is ruled out. The fixing clamp must be turned to prevent contact with the screw if necessary.