



Ford Mondeo Model year 1993-2000 All models with 1.6l, 1.8l, 2.0l Zetec engine

Rough idling, engine stalls, bucking during acceleration.

If there are complaints about the above-mentioned faults with these vehicles, one possible cause is the a leak in the vacuum connection. The problem affects the rubber T fitting beneath the ignition coil on the left of the cylinder head. The T fitting connects the intake pipe with the cylinder head and the exhaust gas recirculation system. Usually, a hissing noise can be heard with the engine running if there is a leak at the T fitting.

For the fault to be eliminated, the rubber T fitting should be replaced.

Bulletin

