



Opel Corsa C 2001–2003 Combo 2001–2003 Astra G 2000–2003 With engine Y17DT / Y17DTL

Engine judder during load alteration or when moving off.

If there are complaints with these vehicles that the engine judders during load alteration or when moving off, one possible cause is incorrect adjustment of the clutch switch. In relation to this, the control unit detects an activated clutch switch even though the clutch pedal is not being depressed. In order to eliminate the fault, the operation of the clutch switch should be checked using suitable diagnosis equipment. If the diagnosis equipment shows an activated clutch switch when the clutch pedal is not depressed, the adjustment of the switch must be corrected.

Note

Please advise the customer that after changing gear, the driver's foot should be taken off the clutch pedal, as otherwise the above-mentioned faults may occur.