© Hella KGaA Hueck & Co., Lippstadt

3. November 2005

Renault Megane I All models with single-spark ignition coils

Engine does not start up and/or misfires

If there are complaints with these vehicles that the engine does not start up and/or misfires, one possible cause is humidity penetration in the spark plug bore hole. In this case, the humidity causes contact problems between the spark plug connectors and the spark plugs.

To eliminate the fault, the spark plug bore holes and spark plug connectors have to be cleaned. The spark plugs should also be replaced. To prevent humidity penetration being repeated, the spark plug connectors must be sealed using silicon grease.

Note:

Only vehicles with Denso ignition coils are affected.

Bulletin





1-1