



VW Golf IV Up to model year 02/1999

Failure of the central locking system, interior lights and reading lights, fuse no. 14 blown.

If there are complaints with these vehicles that the central locking system, the interior lights and the reading lights are not working and fuse no. 14 has blown, one possible cause is a damaged cable loom.

The cables to the boot lid in the area of the roof reinforcement on the C-pillar right and left are affected.

To rectify the problem, any damaged cables must be repaired and must be insulated better against wearing through again.

Fuse no. 14 must be replaced.

Bulletin

