



## ***VW Passat (3B...) Model year up to 2003***

### **Side windows do not close completely**

If there are complaints about the above-mentioned fault, the cause could be due to the window-winder motors not having been initialized. Reinitialization may be necessary after voltage interruption, if, for example, the window-winder motor has been replaced, the battery has been disconnected, or if a fuse has blown. Without initialization, the windows do not have a defined end point any longer (windows fully closed). In this case, proceed as follows:

Disconnect the battery and wait at least 30 seconds. Then, reconnect the battery and switch on the ignition.

Initialization takes place via the respective window-winder switch.

If the windows are open:

- Operate the switch (raising) until the window stops at the upper stop.
- Release the switch.
- Operate the switch (raising) for at least 2 seconds.
- The cutoff will follow automatically.

Initialization for the lower stop (lowering) must be carried out in the same way.



If the windows are closed:

- Operate the switch (raising) for at least 2 seconds.
- Release the switch.
- Operate the switch (raising) again for at least 2 seconds.

Initialization for the lower stop (lowering) must be carried out in the same way.

After initialization, a functional check should be carried out inside the vehicle and via the door lock.

If the vehicle is equipped with an electric sunroof, this can also be initialized in the same way.