



VW

Sharan

All models from 1995 to 2000

Interior fan runs irregularly

If there are complaints about the above-mentioned fault, the fan controller (made up of several resistors) could be the cause. The customer complains that the interior blower only works when switched to the highest level or not at all. In this case, the first thing to do is read out the fault memory. If the fault "fan motor faulty" is displayed, proceed as follows:

- Remove the glove compartment
- Check fan motor for function and voltage supply from the fan controller
- If different values are measured when the blower levels are switched through, or if the voltage collapses completely, this is an indication of a faulty fan controller.
- The fan controller (resistor) is directly next to the fan motor and has a red cover. Replace this by a new controller.
- Then check the interior blower to make sure it is working perfectly.
- Refit the removed parts in reverse order.
- Delete the fault memory.