

© Hella KGaA Hueck & Co., Lippstadt

10. September 2001

4.4

Ford, all vehicle with Zetec engine

Engine jerks or misfires during acceleration under load.

If a costumer complains of rough idling or misfiring during acceleration the reason could be a failing spark to the 3 rd and / or 4 th cylinder. The cause of this failure is current leaking between the spark plug insulator and spark plug connector.

The ignition system can be checked using an engine analyser to locate the fault. If an engine analyser is not avalibale, the ignition parts can be checked by a visual inspection. For this remove the spark plugs and plug leads. Current leakage can be recognized by the presecne of a blkck stipe along the spark plug insulator and white / grey residue inside the plug connector. To repair and cure the fault, exchange the faulty spark plug and the corresponding spark plug lead.







