



Audi A3, A4, A6, A8

Airbag light comes on

If there are complaints about the above-mentioned fault, a faulty plug connection between the interior wiring harness and the airbag module could be the cause.

In this case, replace the plug by using crimp connectors with flux.

Carry out the procedure as follows:

- Disconnect the battery
- Separate the plug from all cables
- Insulate the 0.35 mm² cable approx. 12-14 mm and the 0.5 mm² cable approx. 6-7 mm. Fold the ends of the 0.35 mm² cable back by about half (see photo)
- Insert the ends of the cables into the crimp connector and press together on both sides using a suitable crimping tool. The insulation at the ends of the cables must not be squeezed as well!
- Before shrinking, a pull test should be carried out to check that the cables are fitted securely
- Now shrink the crimp connector using a hot air gun until adhesive escapes at the ends
- Connect the battery and delete the fault memory

