

© Hella KGaA Hueck & Co., Lippstadt

23rd May 2006

Citroen C3 All models with ABS

ABS control lamp illuminates.

If there are complaints with these vehicles that the ABS control lamp illuminates, this could be caused by soiling on the magnetic track of the wheel bearing. A fault entry for the ABS sensor right and/or left is stored in the fault memory. To eliminate the fault, the magnetic track must be cleaned. To do this, proceed as follows:

- Remove the front ABS sensor. •
- Use a soft cloth to clean the magnetic track on the wheel bearing through the ABS-sensor mounting hole.
- Refit the ABS sensor.
- Depending on the entry in the fault memory, clean the other side as well.
- Delete the fault memory.
- Carry out a test drive and make sure the ABS control lamp does not illuminate again.





1-1