



Honda Accord From model year 2001 All models with variable camshaft control (VTEC)

Engine control lamp illuminates, fault code stored.

If there are complaints with these vehicles that the engine control lamp illuminates, and fault code P1259 (VTEC-system malfunction) is stored in the fault memory, one possible cause could be too low an oil level. The variable camshaft control is controlled by the engine oil pressure. If the oil level or the oil pressure is too low, the system may malfunction and the above-mentioned fault may be stored. Before starting costly troubleshooting of the VTEC system, it is essential that the oil level and, possibly, the oil pressure are checked.

Bulletin

