



Mercedes Benz E-Class (W124) with engine no. 111.960 or 104.942/992

Engine cuts out when driving.

If there are complaints with these vehicles that the engine stutters briefly during driving or cuts out completely, one possible cause is a faulty solder joint in the overvoltage protection relay. This fault only occurs sporadically and is not stored in the fault memory.

To eliminate the fault the relay part number must be checked and the relay replaced if necessary.

Old part number: 000 540 **52** 45

New part number: 000 540 **67** 45

Bulletin

