



Mercedes-Benz C-Class (W203) All models

Humidity in the fuse module box in the engine compartment.

If there are complaints with these vehicles that humidity has penetrated the fuse module box in the engine compartment, this could be caused by a leak in the cable ducts. This fault sometimes manifests itself in the exterior lighting or the brake light illuminating on their own accord. To eliminate the fault proceed as follows:

- Remove the cover of the fuse module box.
- Pull the cable harnesses from the guides in the fuse module box (Fig.).
- Remove any humidity and dry all the plugs, cables, fuses and relays.
- Seal the cable duct (cable sleeve) additionally with insulating tape. Begin with the insulating tape on the cable sleeve and apply it to the cable harness as far as necessary for correct sealing to be achieved.
- Insert the cable harnesses back into the guides. Take care to ensure that they are seated correctly.
- Refit the cover.

