



## ***Mercedes SLK 32 K AMG (BM 170), Model year 1999 to 2003, engine code 112.960, 206 kW with automatic transmission***

### ***Loss of power from 120 km/h Transmission does not switch to next gear***

#### **Error memory: P2027**

#### **Which means: Air temperature sensor, temperature implausible**

Induction temperature sensor has been replaced without success.

Since the control of the switching levels depends on the air flow, this is an indication that the actual air flow in the induction tract is too low.

The air mass is also reduced due to insufficient intercooling. In this case, the cylinder filling mass and the injection quantity are not sufficient for the higher power required. This can also be caused by a defective auxiliary water pump for the intercooling.

In this case the power supply and the auxiliary water pump itself must be checked and repaired if necessary.