## **Bulletin**



© Hella KGaA Hueck & Co., Lippstadt

12. July 2006

## Opel Corsa-C and Corsa-C Combo **Opel Agila** From model year 2004 All models with 1.3 L CDTI engine

## Insufficient engine performance

If there are complaints about the above-mentioned fault, the cause could be the EGR diffuser. In addition, it may be that the engine control lamp illuminates, and fault code P 0400 (exhaust gas recirculation – malfunction, flow rate) is stored in the engine control unit. The accumulation of unburned exhaust gas residues causes blockage of the EGR diffuser. In this case, the diffuser must be cleaned. The diffuser is part of the intake pipe (see illustration).



