Bulletin



Opel Meriva B Model year: 2010–2011 Chassis no.: A4000001 – B4231542

Engine does not start.

If the engine of the vehicle listed above does not start, the cause may be a defective power steering hydraulic pump.

To find the source of the fault in this case, the power steering's CAN bus communication must be checked. Proceed as follows if no communication can be established.

- Disconnect the hydraulic pump's cable harness plug (power steering).
- Start the engine.

If the engine starts although the cable harness plug is disconnected, the cause may be a defective hydraulic pump (power steering).

A new hydraulic pump should be installed to correct the problem.



© HELLA KGaA Hueck & Co., Lippstadt

Reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, pictures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved. All rights reserved.

