Bulletin



© Hella KGaA Hueck & Co., Lippstadt

8 January 2007

. . .

Suzuki Grand Vitara 2.0L Model year from 2000 to 2006

Engine control lamp illuminates

If there are complaints about the above-mentioned fault, the cause could be the EGR valve. In addition, the fault code "P0400 - EGR system - Malfunction return exhaust quantity" may also be stored in the fault memory. Due to deposits, the control of the valve may be limited, which then leads to the above-mentioned fault. In this case, proceed as follows:

- Remove the EGR valve.
- With a suitable cloth and a solvent (e.g. petroleum ether), clean the line connection on the exhaust manifold and on the EGR valve, so that no more deposits are present.
- After this, refit the EGR valve.
- To finish off, delete the fault memory.

Bulletin

