



Volvo

C 70, VIN J up to 000690

S 70, VIN 1 up to 489614

S 70, VIN 2 up to 489481

S 70, VIN 3 up to 484419

V 70, VIN 2 up to 434250

V 70, VIN 3 up to 428581

Engine warning light comes on

If there are complaints about the above-mentioned fault, the plug-type connection on the mass air flow meter could be the reason for the problem. In addition, the fault code P0104 "mass air flow meter - temporary interruption of the power circuit" is stored. This fault is caused by poor contacting of the multiple connector on the mass air flow meter. In this case the contacts have to be cleaned and carefully "reworked" using a small screwdriver so that safe contacting can be ensured. In addition, care must be taken that the cable harness from the mass air flow meter cannot touch any other components in the engine compartment. Otherwise vibrations on the plug-type connection could lead to the same fault happening again. When work is completed, delete the fault store and check the system to make sure it is working perfectly.

Bulletin