



VW Passat Model year 2001 (3B..)

Occasional triggering of alarm.

If there are complaints with these vehicles that the alarm is triggered at sporadic intervals, one possible cause is the back-up horn. Corrosion in the back-up horn or plug connections caused by water penetration leads to the above-mentioned fault. To eliminate the fault proceed as follows: Read out the fault store of the comfort control unit. If the fault "No communication with back-up horn" is entered and the message "Last alarm source back-up horn" is in the measured value block, the horn must be replaced and the plug connection checked for correct contact. New alarm horns have improved sealing and are marked with a yellow spot.

Note:

If the above-mentioned faults are not stored in the comfort control unit, the back-up horn is not the cause of the problem.