



## **Audi A4** **With headlight cleaning system (SRA)** **From model year 11.2000**

### **Leaky SRA**

If there are complaints about the above-mentioned faults, there could be several reasons:

- Internal lifting cylinder leaky at the sealing ring.
- Lifting cylinder leaky at the hose connection.
- Hose couplings leaky.
- Connection (quick coupling) of the pump (SRA) leaky.
- Nozzle carriers frozen stiff.

In this case proceed as follows:

- Check whether water is escaping directly at the cylinder. If yes, replace the cylinder.
- If there are leaks at the hose connection of the lifting cylinder, check the O-ring for damage and replace if necessary. The old sealing ring is blue, the new improved version is black.
- If water escapes at the joints between the hoses, set hose clamps at the ends.
- Check the quick coupling for leaks and replace if necessary.
- Lubricate the nozzle carriers a little.

**Bulletin**