

© Hella KGaA Hueck & Co., Lippstadt

11 September 2006

Ford Transit Model year from 01/02/2000 to 30/04/2002

Failure of the exterior lighting

If there are complaints about the above-mentioned fault, the cause could be a damaged wiring harness. In addition, fuses 3, 7, 9, 23, 24 in the fuse box/engine bay and fuses 49 and 51 in the fuse box/interior may also be blown.

In this case, proceed as follows:

- Remove the driver side headlight.
- Separate the connection plug from the headlight.
- Check the sheathing of the wiring harness for mechanical damage (chafing points, bare cables).
- If the wiring harness is damaged, the cables affected should, according to damage, be re-insulated or repaired by means of insulating splices.
- Then cover the wiring harness self-sealing adhesive tape (Hella no.: 9MJ 735 430-001) or with a flexible flute tube.
- Refit removed parts in reverse order.
- Check the above-mentioned fuses and, if necessary, replace.
- Check the lighting system to make sure it is in perfect working order.



