



Golf V with standard series fog lights

Bulb failure light comes on when additive cornering light has been installed

If the above-mentioned fault occurs, the root of the problem could be the missing standard series fog lights. If the additive cornering light from Hella (DynaView® Evo2) is installed in the above-mentioned vehicles, the already present standard fog lights have to be removed first. With the Golf V, the lighting equipment is always checked for perfect function when the ignition is started. The lack of standard fog lamps is evaluated as a fault by the fault control feature. To avoid this, two additional adapters have to be installed. These simulate the two missing fog lights. The adapters can be ordered under the part number 9XD 165 529-801. Installation instructions are included.

Bulletin

