



Mercedes Benz C-Class (Type 202, 208) E-Class (Type 210)

Defective fog lights

If there are complaints about the above-mentioned fault, the plug contact on the bulb could be charred (see Fig. 1). As the plug can no longer be removed from the bulb, the entire plug must be replaced along with the H1 bulb. In this case, proceed as follows:

- Remove the affected bulb.
- Cut off the earth cable approx. 80 mm behind the plug. Cut off the positive cable approx. 60 mm behind the plug.
- Strip the insulation from the cable ends.
- Crimp the new bulb plug with pre-assembled cables (see Fig. 2, Hella part. no.: 8KB 863 949-001) to the cable ends and shrink the ends using a hot-air hair dryer.
- Insert a new bulb into the headlight and connect to the plug.
- Check the operation of the system.

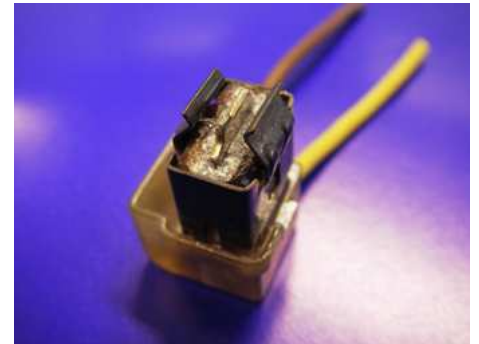


Abb. 1



Fig. 2