



Mercedes Benz E-Class (W210)

Insufficient headlamp cleaning

If there are complaints about the above-mentioned fault, this could have several causes:

- Centrifugal pump is not running
- Hose is leaking
- Blocked or faulty valve
- Blocked nozzle
- Damaged telescopic arm



In this case proceed as follows:

- Actuate the washing function. If the centrifugal pump is not running (clearly audible noise) the voltage supply including fuse must be checked and replaced if necessary.
- If the voltage supply is OK, check the pump and replace if necessary.
- Check the hose routing and change it if necessary to guarantee perfect water flow. Seal any leaks or repair the hose.
- Check the valves within the hoses for soiling. Remove foreign particles by flushing the system.
- Check the washing nozzles at the end of the telescopic arms for soiling. Remove foreign particles by flushing the system.
- Check the telescopic arm to make sure it is functioning properly. Repair or replace if necessary.
- Following repairs, adjust the nozzles in such a way that optimum cleaning is achieved.