



Renault Clio 2

All vehicles with fog lights

Water in the fog lights

If there are complaints about the above-mentioned fault, the cause could be the cable seal of the fog lights. In this event, a conversion set consisting of a modified cable loom + two protection caps is available from the manufacturer.

Proceed as follows:

- Raise the vehicle.
- Remove the front apron.
- Dismantle the rear panelling of the fog light, drain the water and, using a hair dryer for example, remove fogging present in the light.
- Replace the old cable loom with the new one.
- Mount the protection covers (see illustration, Item A) with the aid of a fastening screw (see illustration, Item B) on the underside of the fog lights.
- Refit removed parts in reverse order.
- After this, readjust the fog lights.

