



Renault Espace IV

All vehicles with headlight cleaning system

Headlight cleaning system does not work

If there are complaints about the above-mentioned fault, the cause could be that the telescopic jets are blocked. The complaints may occur with the cylinder extended or retracted. In this case, the telescopic cylinders must be replaced.

Proceed as follows:

- Remove the covers of the spray jets.
- Release the snap-in fitting of the spray jets and remove the spray jets from the telescopic cylinders.
- Dismantle the front apron.
- Check whether washers are fitted to the fastening points, between the cylinders of the cleaning system and the impact absorber.
- If the washers are not present, a bag with suitable washers is offered by the manufacturer.
- Release the plug-type couplings of the water hoses on the telescopic cylinders and remove the hoses.
- Remove the old telescopic cylinders. Fit the new telescopic cylinders with the washers.
- Refit removed parts in reverse order.
- Check the operation of the headlight cleaning system by activating it several times.