## **Bulletin**



© Hella KGaA Hueck & Co., Lippstadt

12. Juli 2005

## Volvo C 70 VIN J up to 009078 S 70 VIN 1 up to 571319 S 70 VIN 2 up to 571822 V 70 VIN 2 up to 549452

## **Humidity in the indicators**

If there should be complaints about the above-mentioned fault, a missing ventilation opening could be the cause. In this case proceed as follows:

- Remove the front indicators.
- Use a drill (3 mm) to carefully drill several holes next to one another at the position illustrated (below). Make sure that the lenses are not damaged.
- Remove the bridge between the holes so that a hole 8 mm long is produced.
- File down and deburr the longitudinal hole using a file.
- Blow out the light unit using compressed air.
- Replace the indicators and check that they are working properly.





