



VW Polo 9N - rough running of the engine and possibly problems with the exhaust emissions test (AU)

Data sheet	
Manufacturer	Volkswagen
Vehicle model	Polo 9N
Engine	BME
Year of manufacture	2001 - 2009
Symptoms	Rough engine running

Important safety note

Engine runs rough / problems with the exhaust emission test (AU)


A defective plastic hose of the vent valve on the engine ([Fig. 1](#)) can be the cause of rough engine running in the above-mentioned vehicle. Sucking in "false air" can also cause problems with the exhaust emission test.

In such a case, the damaged, worn-through area ([Fig. 2](#)) cannot always be easily located. Furthermore, the noise caused by the leakage is also not always present or its occurrence depends on the engine speed/engine vibration.

In order to rectify the problem, the top covering the engine has to be removed. Then remove the two screws of the vent valve (which is attached to the top of the engine). Unclip the venting hose on the intake manifold. Replace valve and hose. Make sure that the hose is laid correctly.

ⓘ IMPORTANT

This information may also apply to other engine codes.

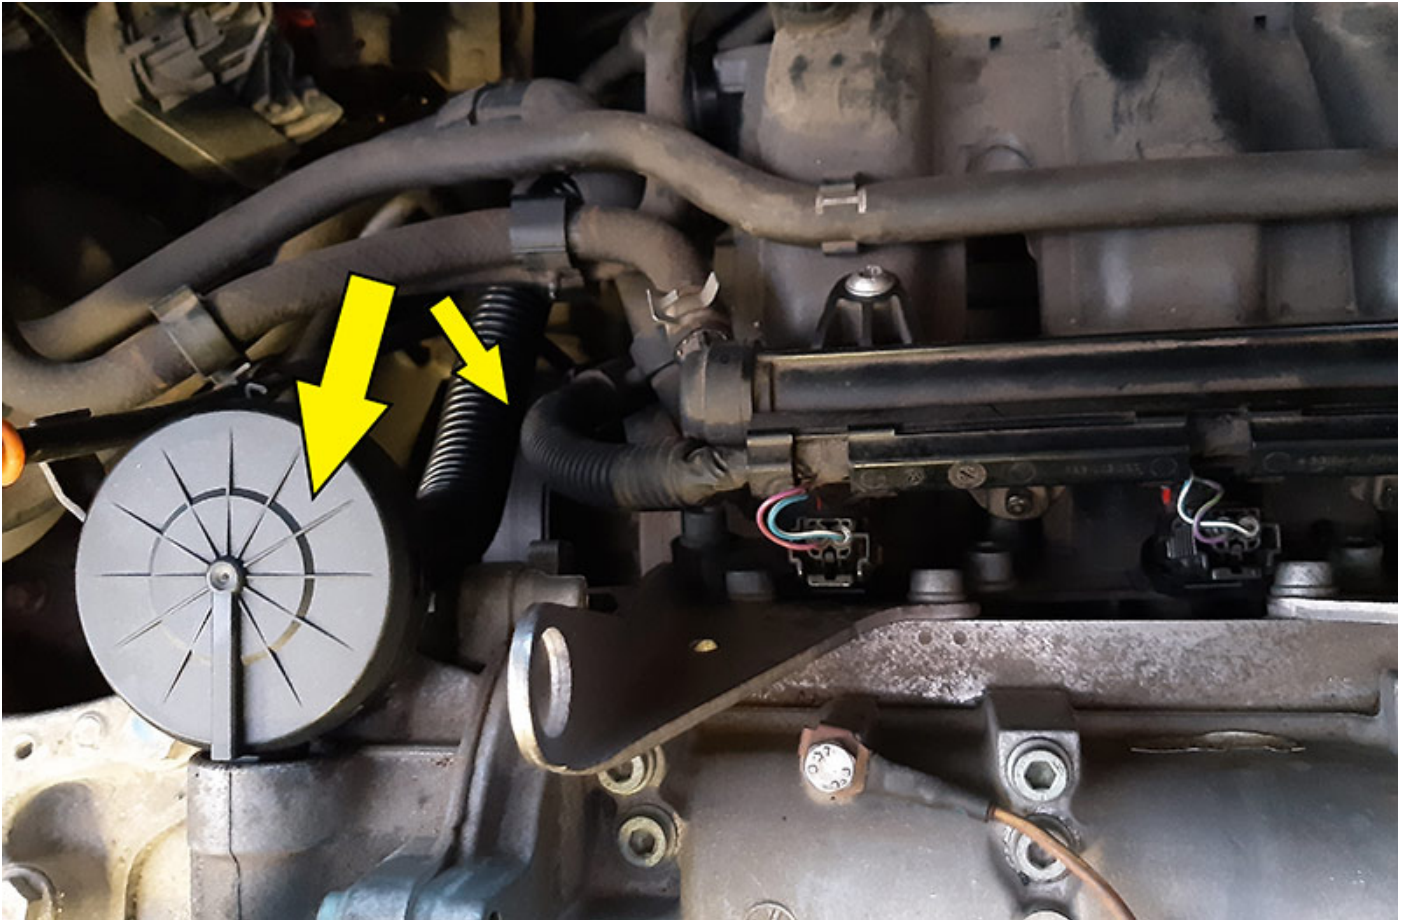



Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.