BMW 3 Series Gran Turismo - Howling noises in the area of the vehicle underbody

Data sheet	
Manufacturer	BMW
Vehicle model	3 Series Gran Turismo
Type	F34
Year of manufacture	From 2013
Symptoms	Howling noises in the area of the vehicle underbody, starting at a speed of 90 km/h and upwards.

Important safety note


BMW 3 Series Gran Turismo - Howling noises

If the above-mentioned problem is detected, a possible cause may be too large a gap at the transition between the front and central underbody cover.

Remedy:

- First remove the central underbody protection cover.
- Thoroughly clean the area marked in the picture and fit the foam pad OE No. 16111181918 according to the vehicle manufacturer's instructions.
- Refit the central underbody protection cover.

Finally a test drive should be performed in order to run checks on the repair work.

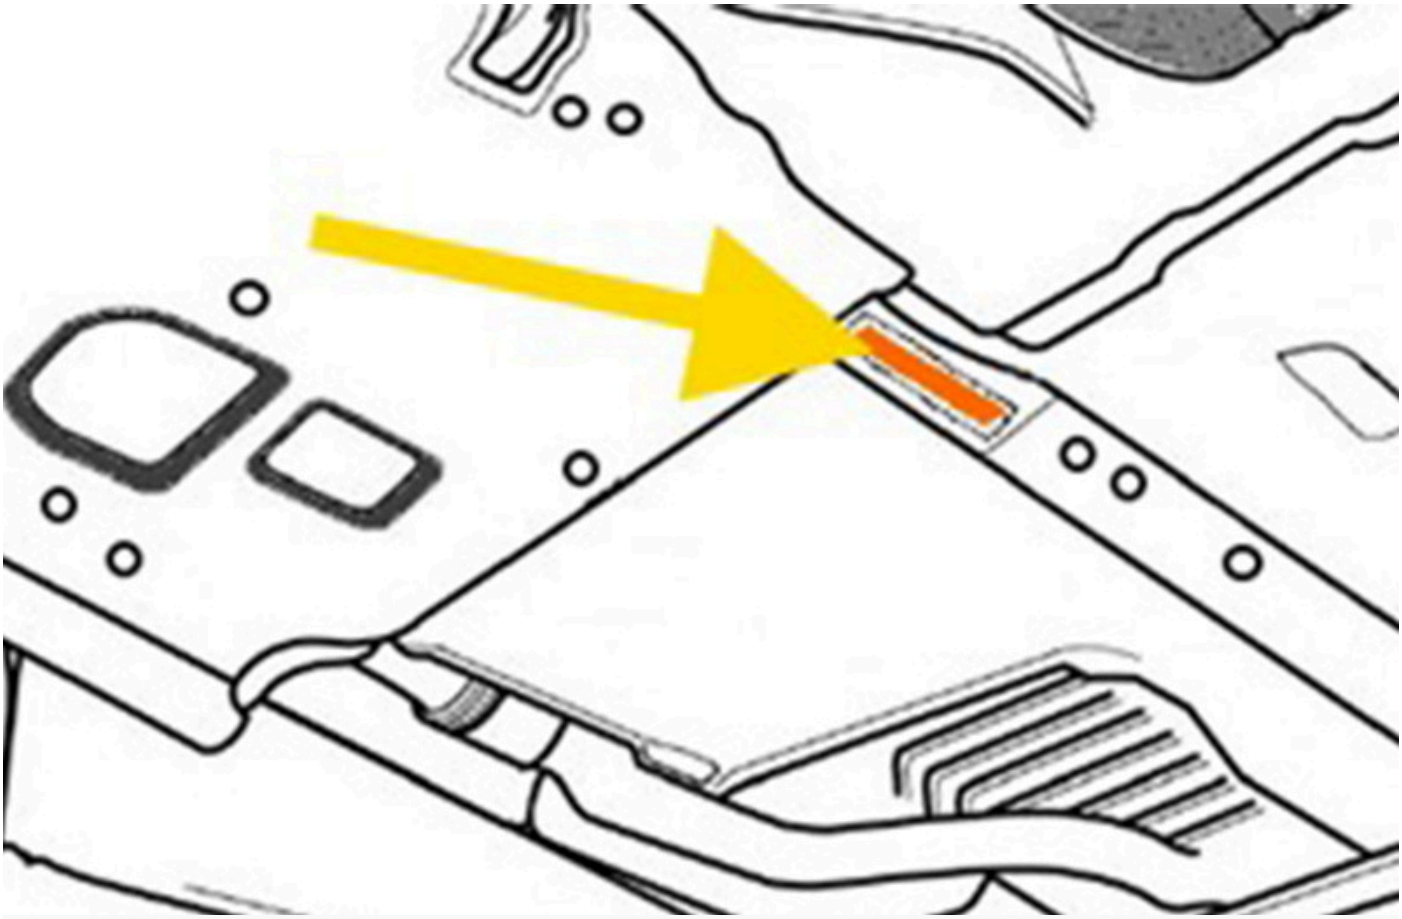

Thoroughly clean the area marked in the picture and fit the foam pad OE No. 16111181918 according to the vehicle manufacturer's instructions.

Please note

Please note that such work should only be carried out by an authorised specialist workshop and that the vehicle manufacturer's repair and maintenance instructions must be observed!

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.