

Jaguar S-Type - Ticking Sounds From Instrument Panel Area | HELLA

Jaguar

S-Type (X200)

Model Year: 1999 – 2008

Ticking Sounds

From Instrument Panel Area


In the vehicles listed above, ticking noises can arise from the instrument panel or the instrument cluster area.

The potential cause for this is one or more actuator motors of the heating/air-conditioning system.

Vehicles with the following chassis numbers may be affected: N53000 - N91220

Proceed as follows to rectify the problem:

- Exactly locate the source of the noise
- If required, carry out an actuator test
- Replace the affected actuator motors
- Read out/clear the error memory
- Program the actuator motors

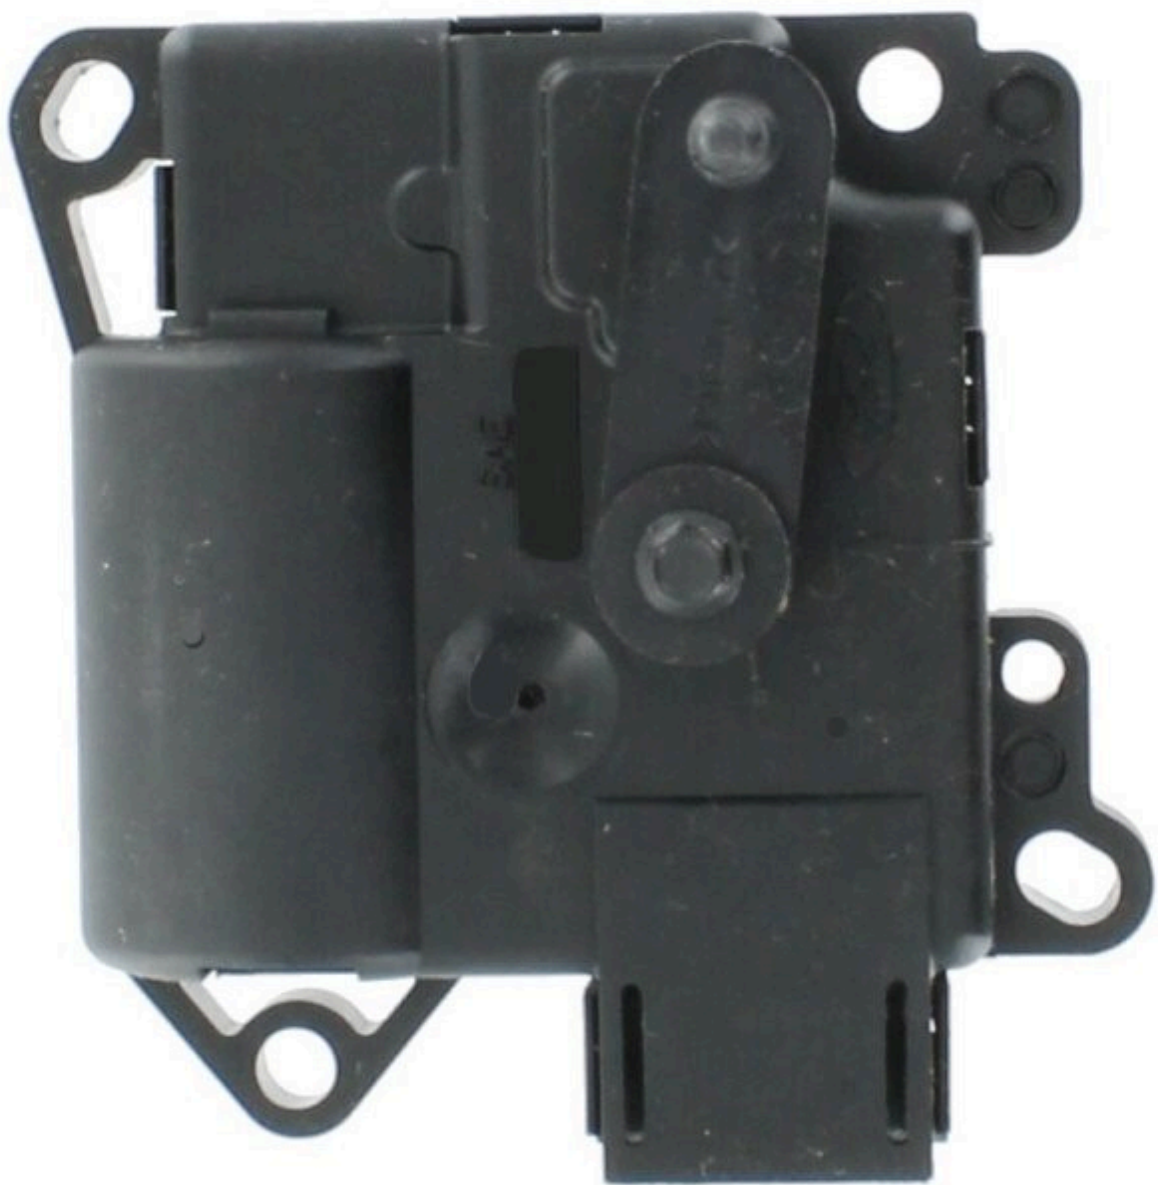

Important safety note

Technical information and practical tips have been compiled by HELLA in order to provide professional support to vehicle workshops in their day-to-day work. The information provided on this website is intended for use by suitably qualified personnel only.

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval and indication of the source. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.