

Citroën C3 Pluriel - Vandindtrængen i baglygte | HELLA

Citroën C3 Pluriel (HB) Vandindtrængen i baglygte ovennævnte modeller kan funktionerne i baglygterne svigte som følge af indtrængende vand (fig. 1). Baglygten skal afmonteres for at der kan foretages en bedømmelse. Det gøres ved at afmontere de to skruer (fig. 2). Derefter klikkes lygten fri til siden (fig. 3), tages ud, og pærerne tages ud. Se efter forureninger og korrosion (fig. 4). I de fleste tilfælde skyldes utætheden en defekt svejsesøm i plastmaterialet (over lygten) (fig. 5). Fig. 1 Fig. 2 Fig. 3 Fig. 4 Fig. 5

C3 Pluriel (HB)

Water entering rear combination lamp

On the vehicles mentioned above, there is a risk of the rear combination lamp functions failing due to water ingress (Figure 1).





Figure 1 Figure 2



Figure 3



Figure 4

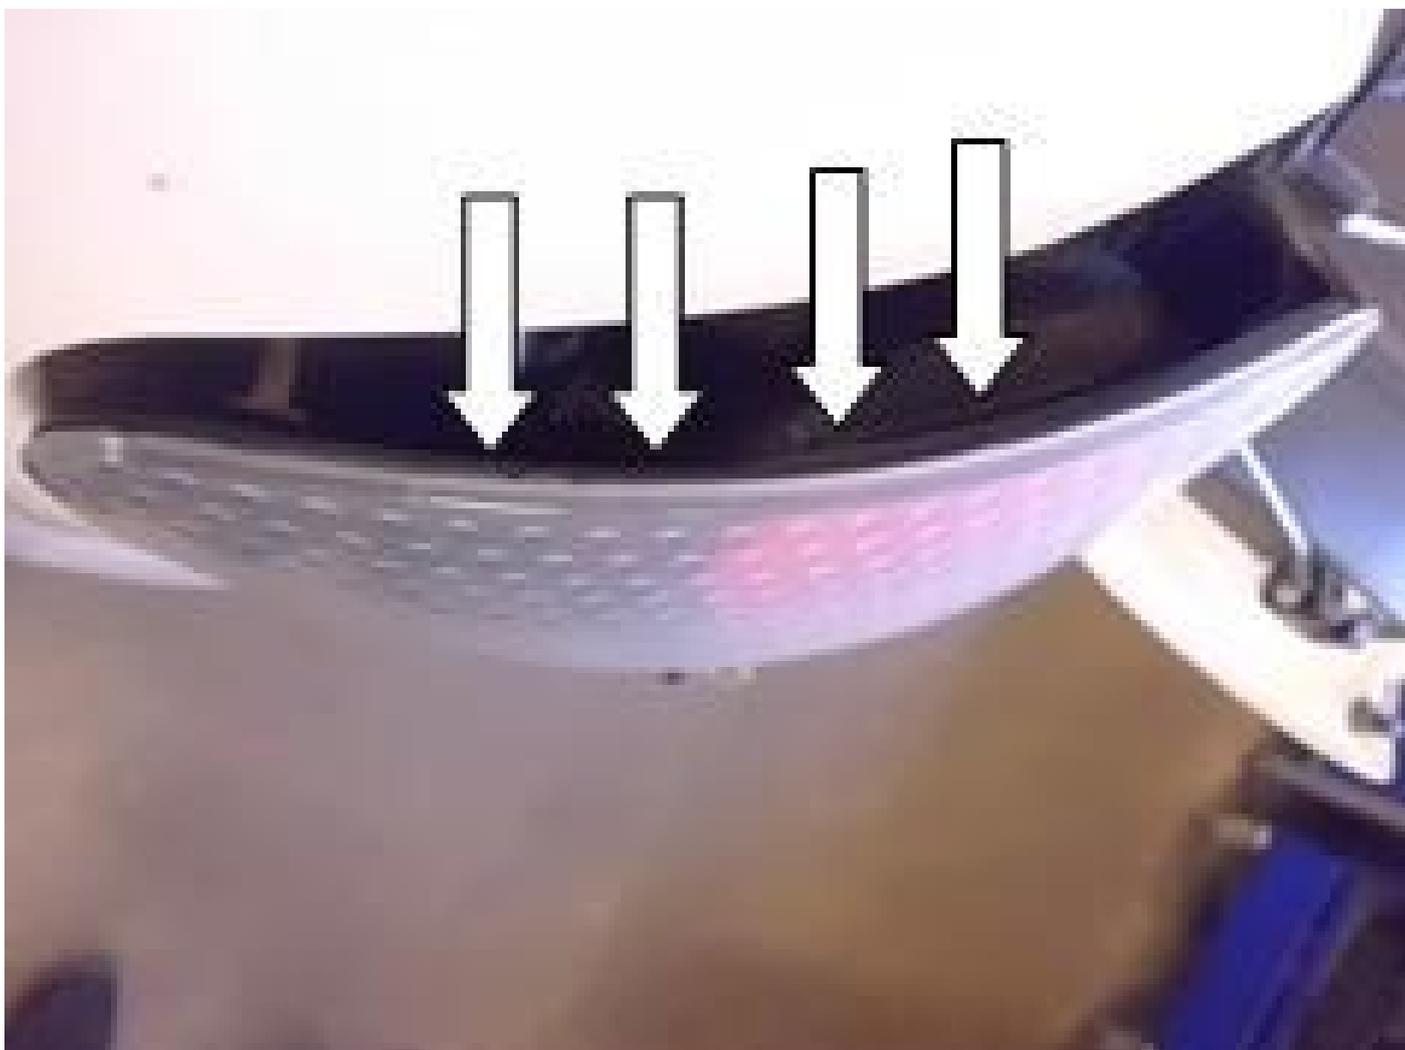


Figure 5

ⓘ Important safety note

The following technical information and tips for practical use have been set up by HELLA in order to offer professional support to automotive workshops in their daily work. The information available here on this website is only to be used by appropriately trained specialist staff.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.