

Fiat Scudo - Onvoldoende capaciteit van het aircosysteem | HELLA

Fiat


Scudo 1,6D Multijet 90

Bouwjaar: vanaf 2007 tot en met VIN 84160387

Onvoldoende capaciteit van het aircosysteem

Wordt bij de bovengenoemde voertuigen een onvoldoende koelcapaciteit resp. een koudemiddelverlies vastgesteld, kan dit worden veroorzaakt door een lekkage in de koudemiddelleiding tussen condensor en compressor.

De koudemiddelaansluiting op de juiste uitvoering controleren en evt. vervangen. (Zie afbeeldingen)

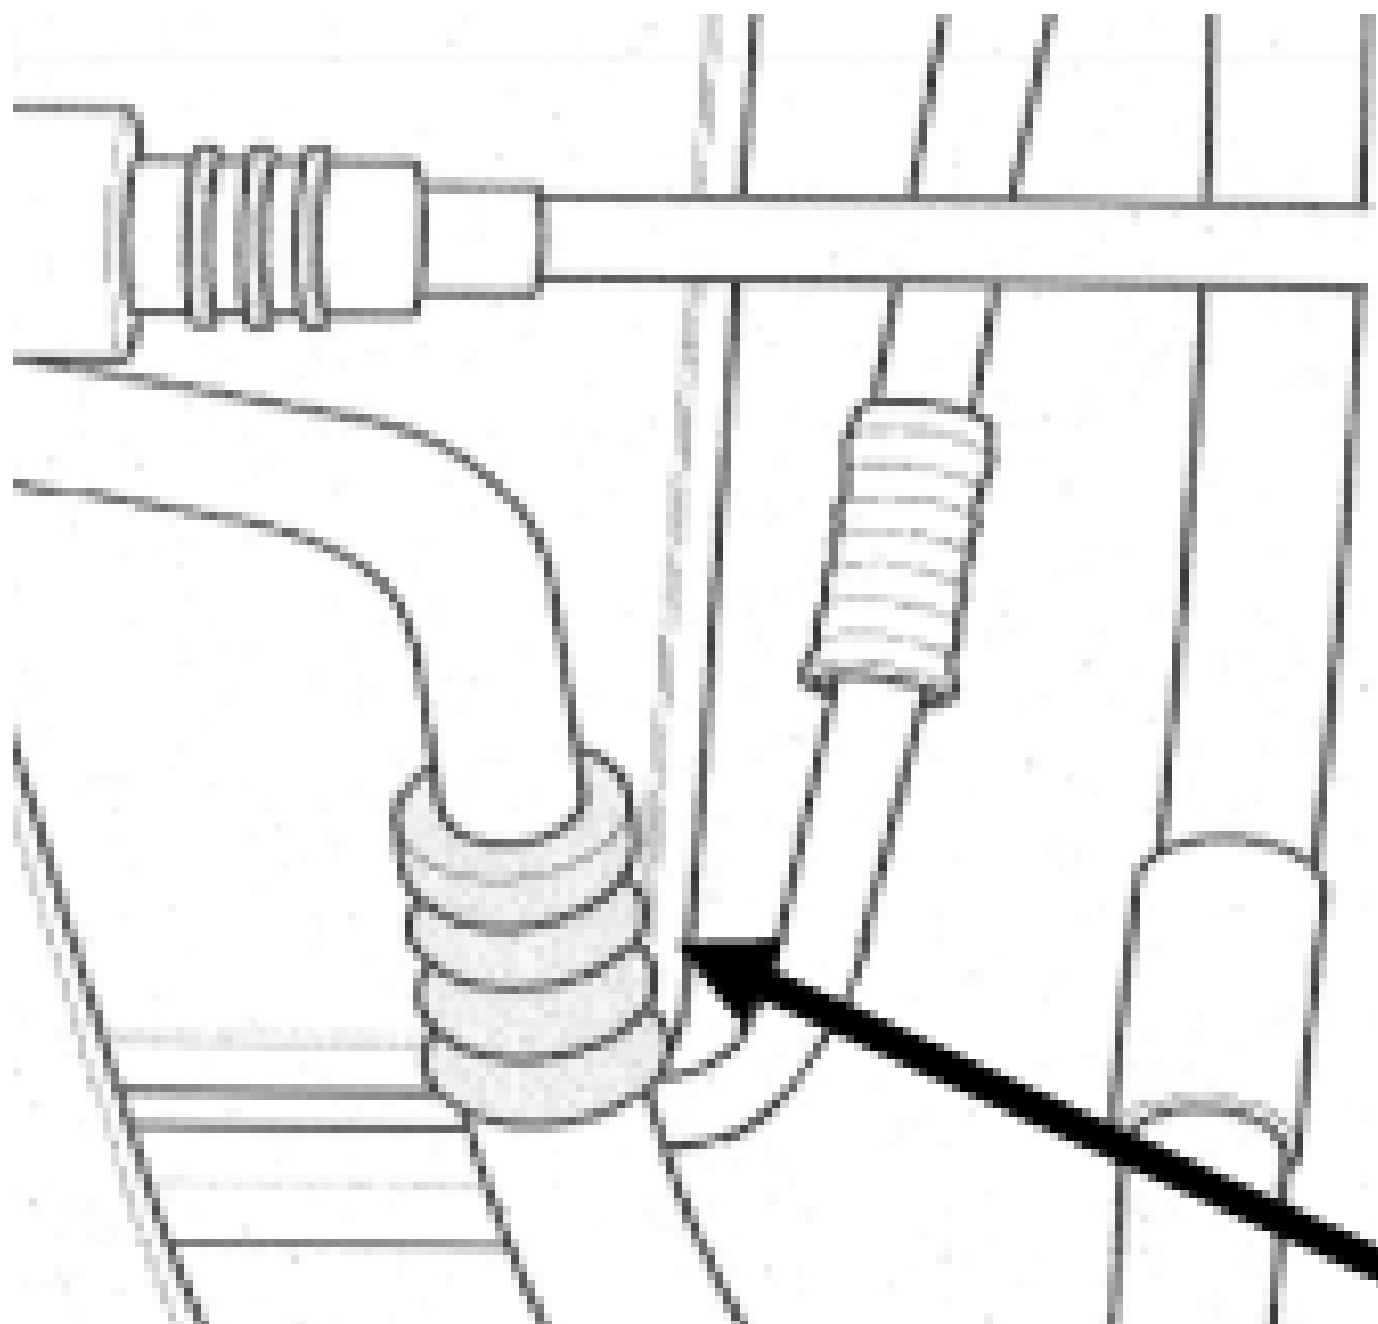



- Oude uitvoering -

De voertuigfabrikant heeft hiervoor een gewijzigde uitvoering [Reserveonderdelen (RO)]

- 1 stuks: Koudemiddelleiding (RO): 140142280

- 2 stuks: O-ring: (RO): 9645950980

Important safety note

The following technical information and tips for practical use have been set up by HELLA in order to offer professional support to automotive workshops in their daily work. The information available here on this website is only to be used by appropriately trained specialist staff.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.