

Skoda Fabia II - Functiestoring; zijknipperlicht | HELLA

Skoda

Skoda Fabia II

Bouwjaar: 2007 - 2014

Functiestoring; zijknipperlicht

Als bij het bovengenoemde voertuig (afb. 1) een functiestoring optreedt aan het zijknipperlicht (afb. 2), kan dit worden veroorzaakt door een defecte aansluitkabel.




Abb. 1

Afb. 1



Abb. 2

Afb. 2

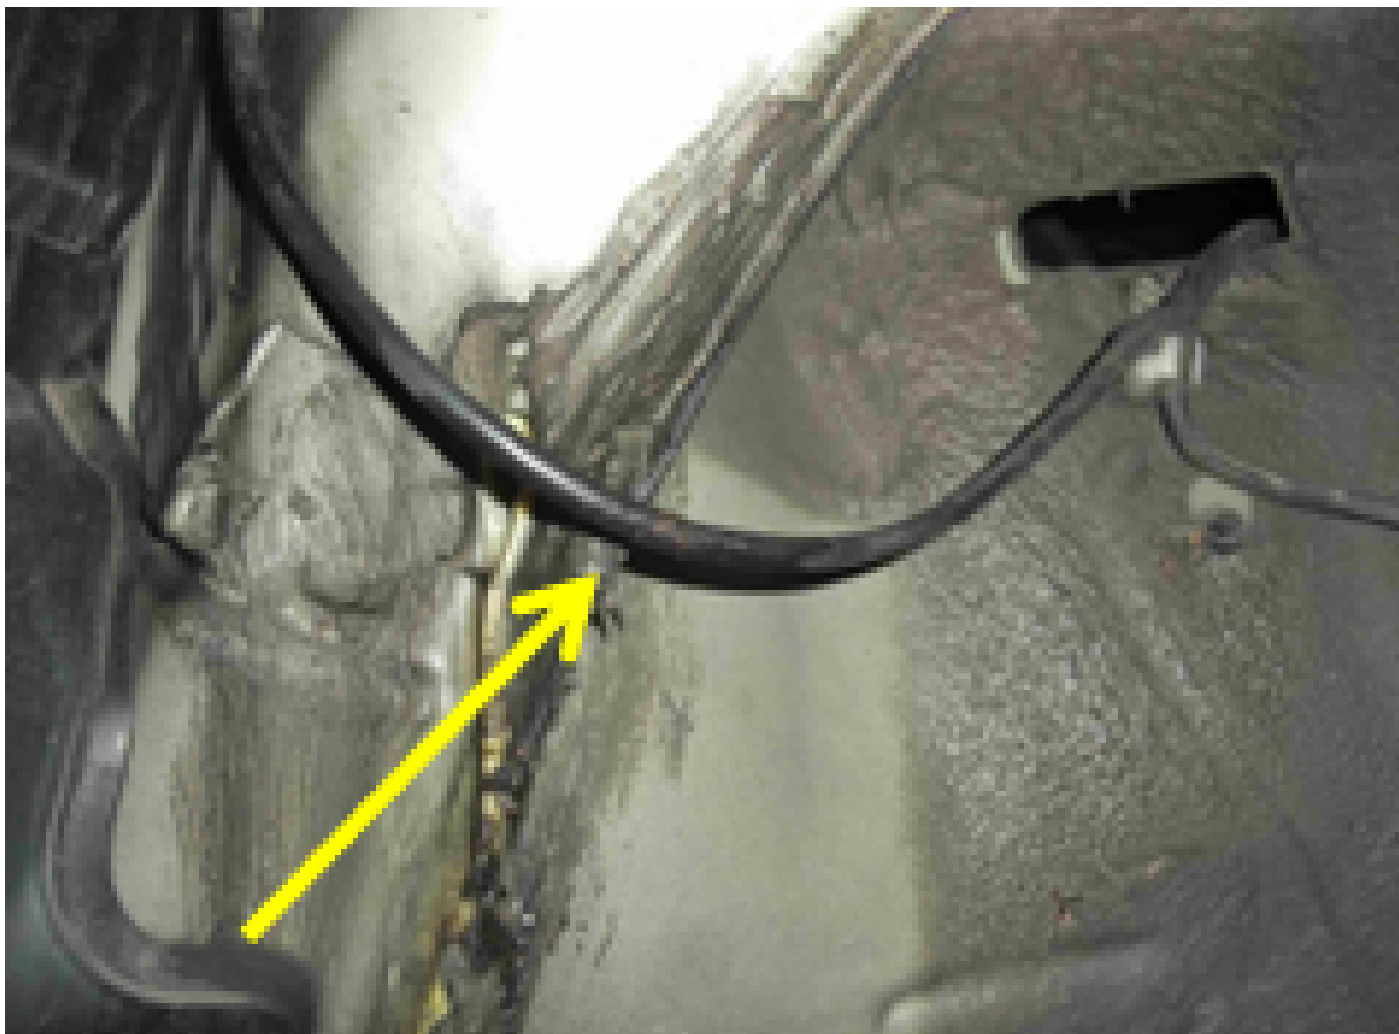

- Demonteer voor de foutanalyse het wiel en de bekleding van de wielkast. Repareer de defecte kabel op de juiste manier. Zorg er vervolgens voor dat de kabels correct worden verlegd (randbescherming).

Zekering controleren, evt. vervangen.

Werkingscontrole uitvoeren (afb. 4).



Werkingscontrole uitvoeren (afb. 4)

Important safety notice

The following technical information and tips for practical use have been set up by HELLA in order to offer professional support to automotive workshops in their daily work. The information available here on this website is only to be used by appropriately trained specialist staff.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.