

Citroën C3 Pluriel — Infiltração de água na luz traseira | HELLA

Citroën C3 Pluriel (HB) Infiltração de água na luz traseira Nos veículos supracitados, uma infiltração de água (Figura 1) pode implicar a falha das funções das luzes de marcha-atrás. Para um diagnóstico correto, deve-se desmontar a luz de marcha-atrás. Para isso, deve-se desenroscar os dois parafusos (Figura 2). Em seguida, deve-se desencaixar o farol lateralmente (Figura 3) e desenroscar os alojamentos das lâmpadas incandescentes. Prestar atenção a sinais de sujidade e corrosão (Figura 4). Na maioria dos casos, a infiltração de água deve-se a uma costura de solda com defeito (Figura 5) do plástico (acima do farol). **Figura 1 Figura 2 Figura 3 Figura 4 Figura 5**

C3 Pluriel (HB)

Water entering rear combination lamp

On the vehicles mentioned above, there is a risk of the rear combination lamp functions failing due to water ingress (Figure 1).





Figure 1 Figure 2



Figure 3



Figure 4

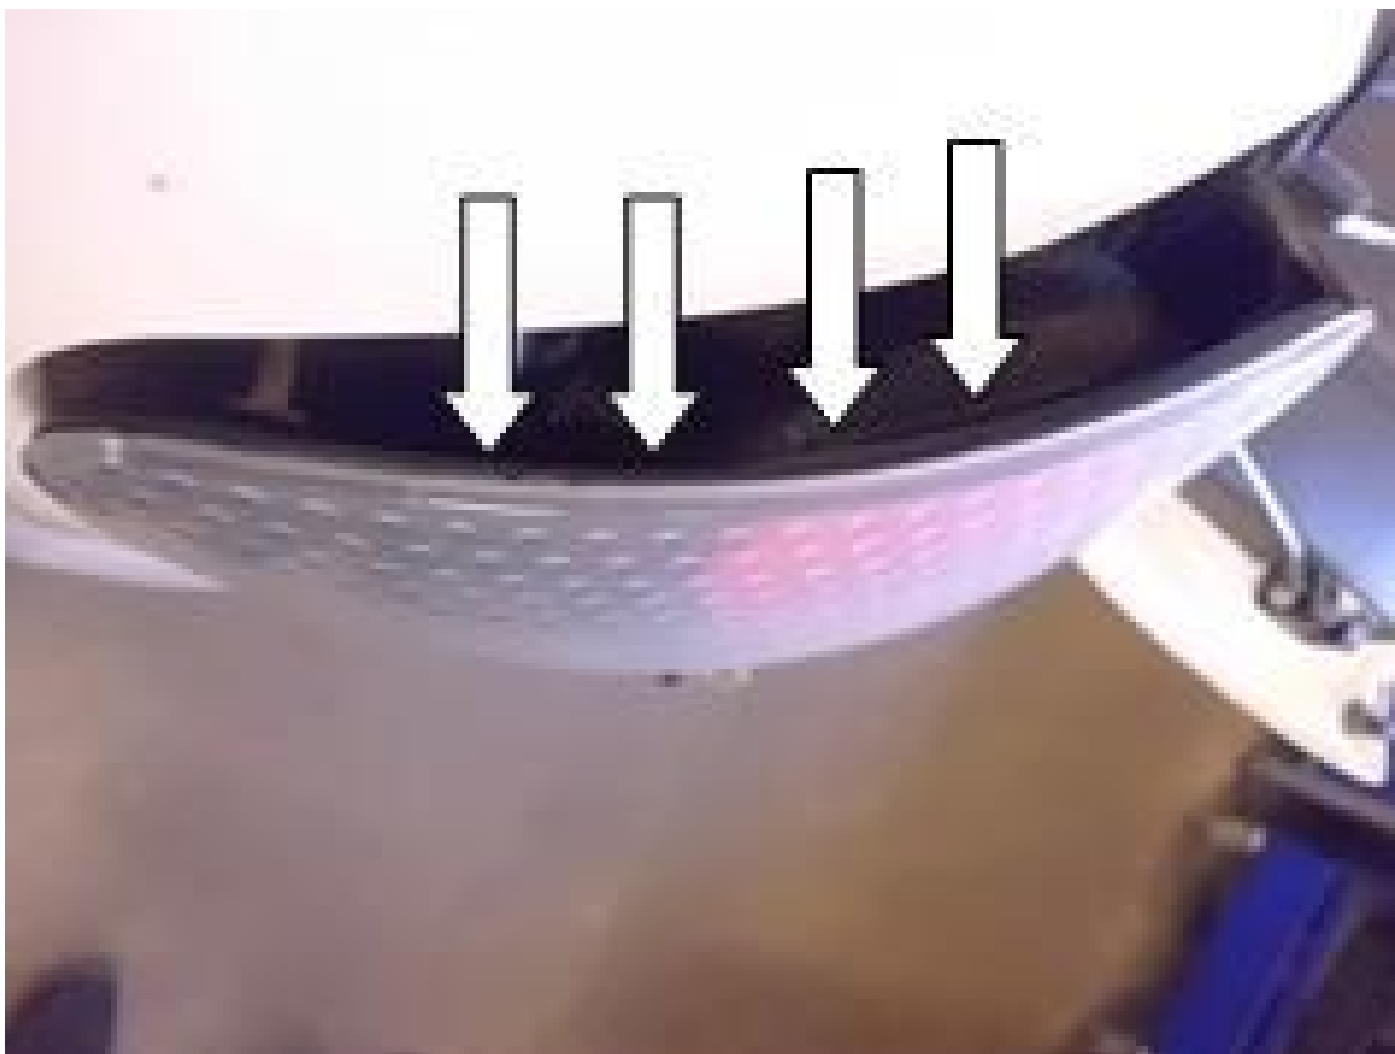


Figure 5

Important safety note

The following technical information and tips for practical use have been set up by HELLA in order to offer professional support to automotive workshops in their daily work. The information available here on this website is only to be used by appropriately trained specialist staff.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.