



# Vauxhall Astra-J Sports Tourer: display code 16

## Data sheet

Manufacturer Vauxhall

Vehicle model Astra J

Symptom Display code 16

### i Important safety note

# Vauxhall Astra-J Sports Tourer: display code 16

Code 16 appears on the display (<span class="gallery-mode--link" data-order="1">Fig.1</span>) with information, see operating instructions. Error code Diagnosegerät\_B3881 corresponds to faulty tail light lamp or circuit.

Check light functions and, in this case, replace the stop light bulb. To do this, open the rear interior trim and loosen the two wing nuts (<span class="gallery-mode--link" data-order="2">Fig.2</span>). Then remove the rear lamp from the vehicle body towards the rear.

Replace P21W bulb (<span class="gallery-mode--link" data-order="3">Fig.3</span>). Check plug contacts for corrosion.

If necessary, delete the error message stored in the control unit via the diagnostic device. Reassemble in reverse order.



Fig. 1: Code 16 appears on the display

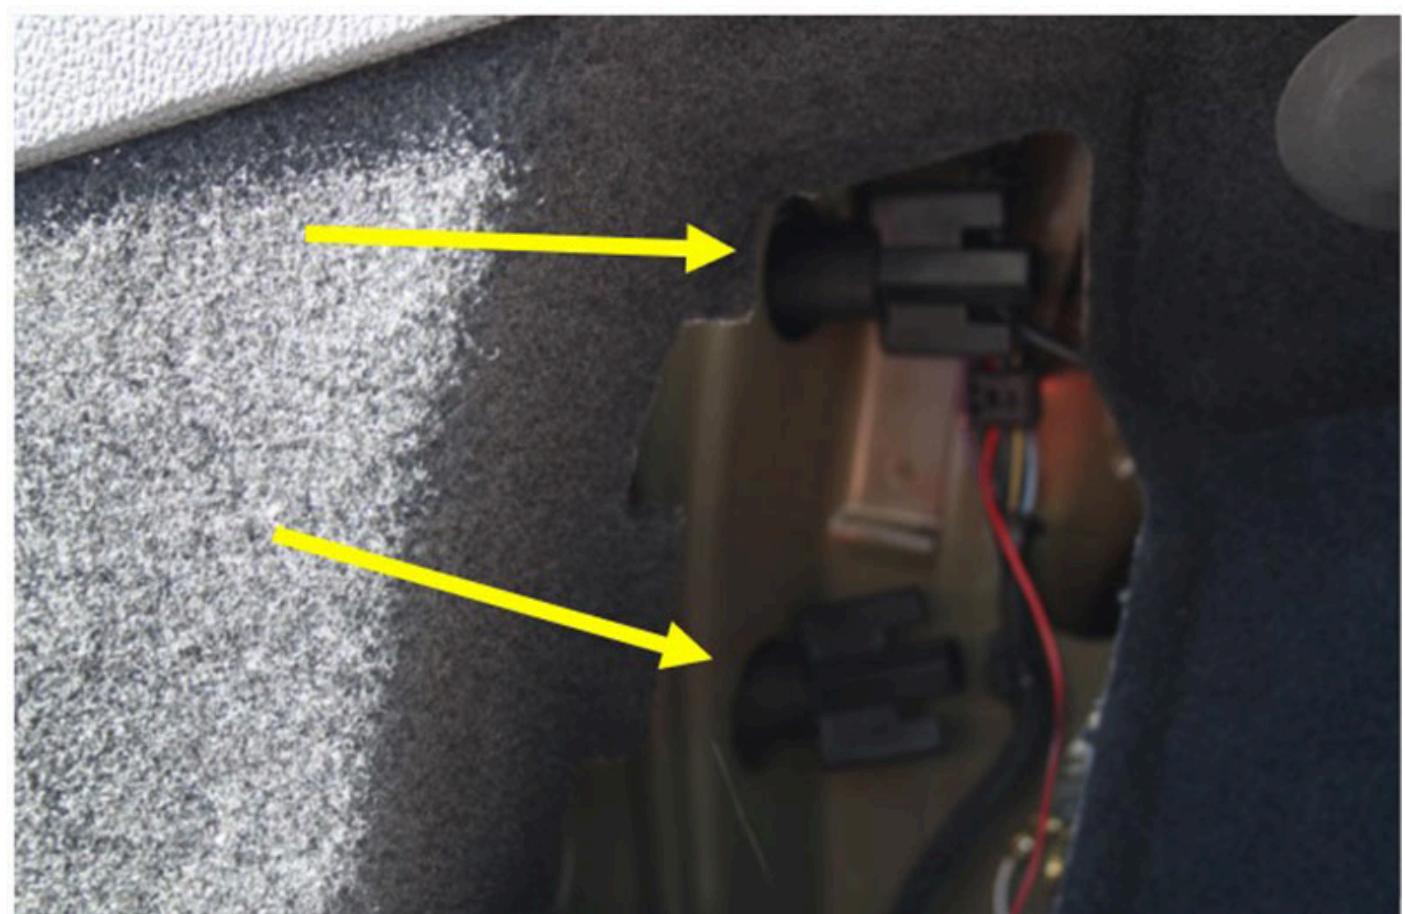


Fig. 2: Internal trim

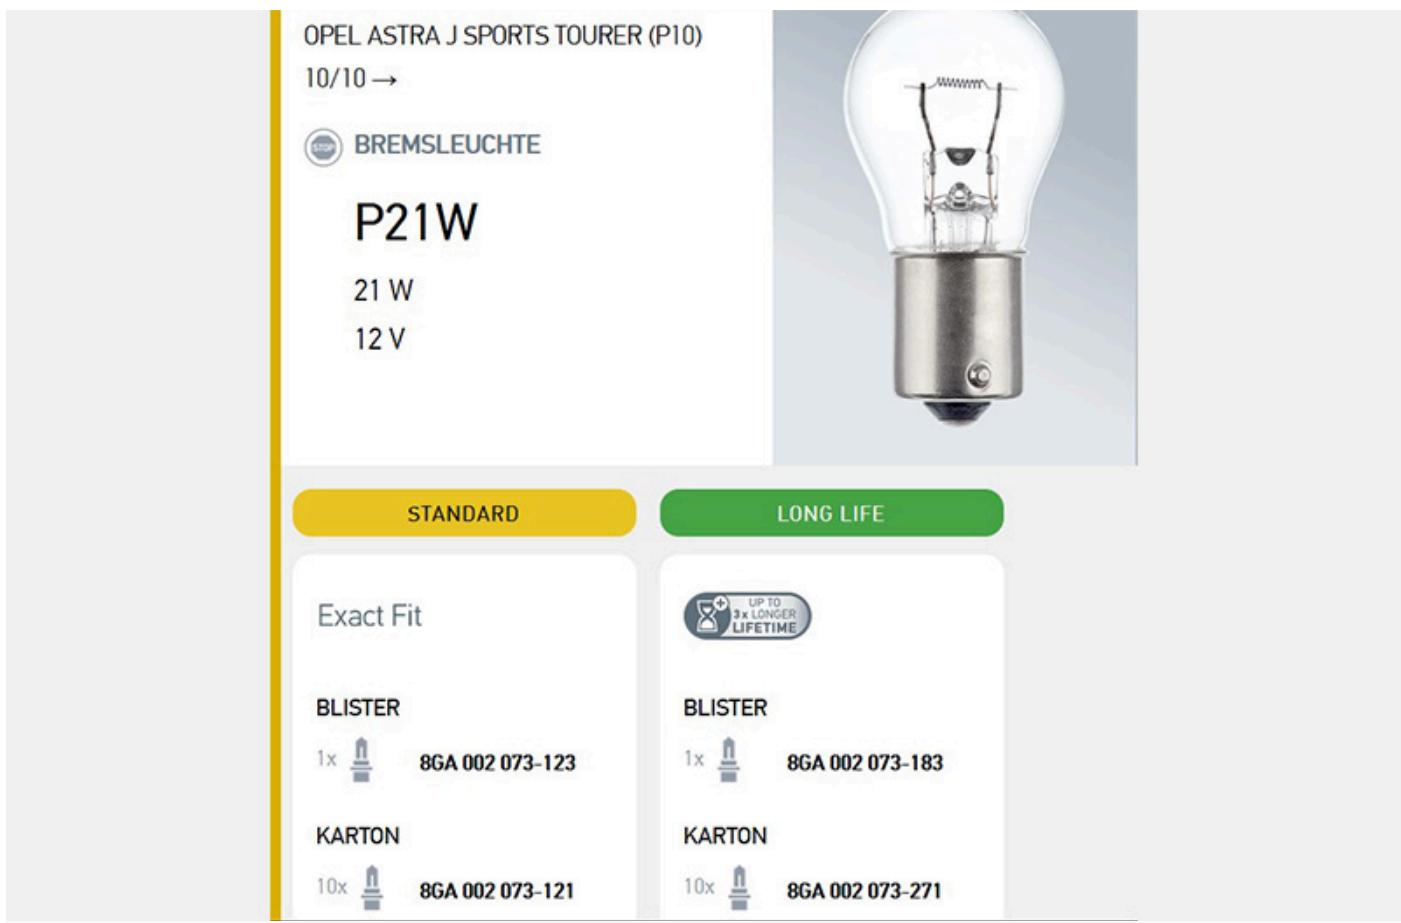


Fig. 3: P21W bulb

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.