

Citroen C4 Picasso - Engine will not start | HELLA

Citroen

Starting from model year 2006

All vehicles with a sequential manual gearbox

Engine will not start

If a customer complains about the above error, this could be caused by a defective plug connection. Due to poor contacting, the display indicates drive position "A1" in the cockpit, although the selector lever is in neutral position. As a result, the engine will not start. In addition, error codes for the manual gearbox may be stored. In this case, flawless contact between the drive position switch and the multi-contact plug must be tested; see figure1 and 2. If the plug socket has been disengaged, secure fit must be permanently established.



Fig. 1

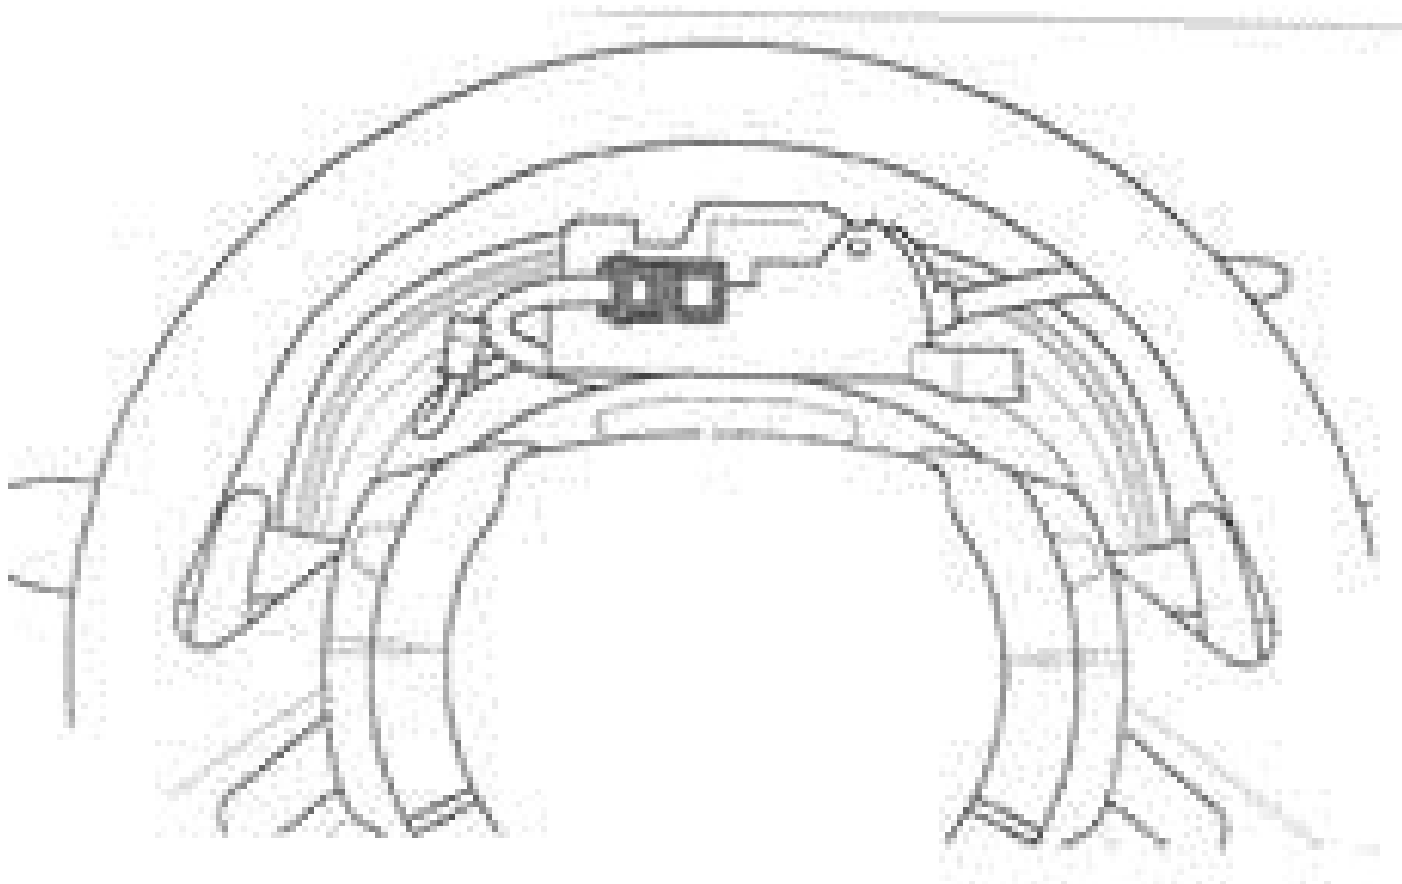


Fig. 2

ⓘ Important safety note

The following technical information and tips for practical use have been set up by HELLA in order to offer professional support to automotive workshops in their daily work. The information available here on this website is only to be used by appropriately trained specialist staff.

The reprinting, distribution, reproduction, exploitation in any form and disclosure of the contents of this document, even in part, is prohibited without our express written approval and indication of the source. The schematic illustrations, figures and descriptions are for explanation and presentation of the document text and cannot be used as a basis for installation or design. All rights reserved.