Fiat Grande Punto - Warning light for electronic stability program (ESP) lights up | HELLA

Fiat

Grande Punto

Model Year 2005-2009

All left-hand drive models

Warning light for electronic stability program (ESP) lights up

If the above-mentioned defect is discovered in connection with permanently lit-up stop lights, a possible cause responsible for this is a faulty fastening element.


The fastening element fixes the pressure rod for the brake booster on the brake pedal.

Occasionally it is also not possible to engage the first gear in vehicles which have the "Dualogic" automatic transmission.

Remedy

Check the fastening element (A) of the pressure rod above the pedals and, if necessary, replace.

Please observe the maintenance and repair notes provided by the vehicle manufacturer in this context.

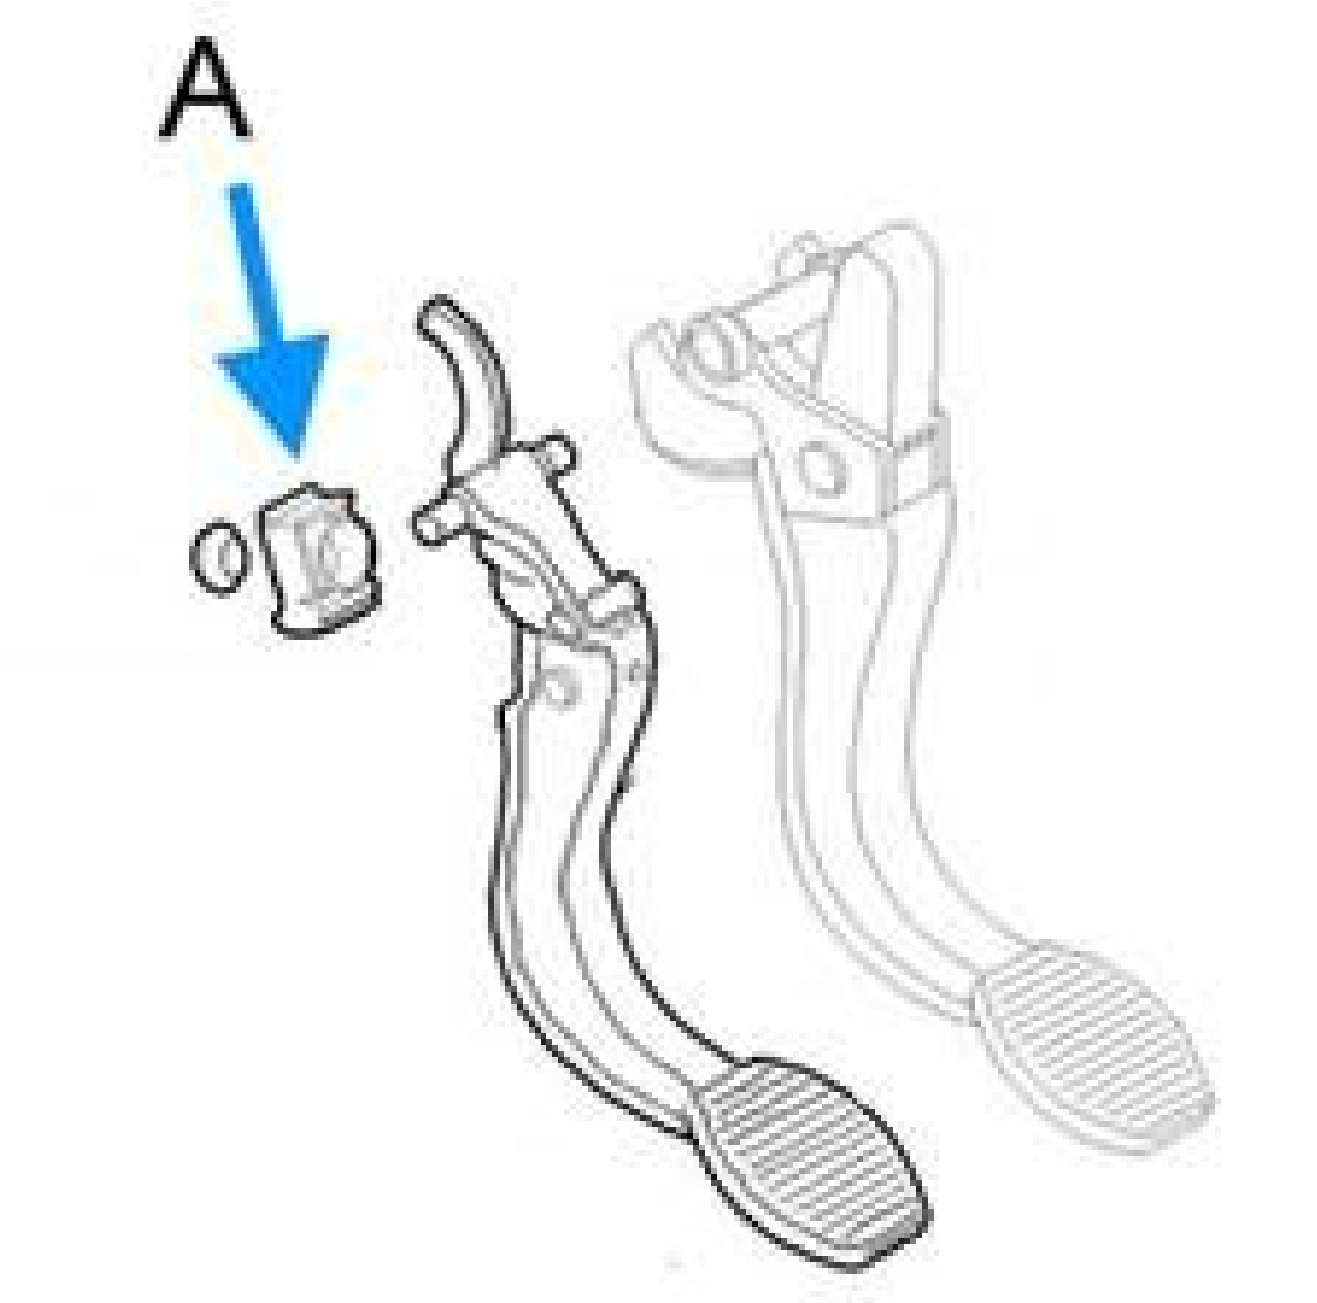

Repair notes

Fiat - service part number: 46755874