



VW Beetle - non-functioning parking aid

Data sheet

Manufacturer	Volkswagen
Vehicle model	Beetle (5C)
Year of manufacture	2011 - 2019
Symptoms	Failure of backup and warning alarm / parking aid

Important safety note

Non-functioning parking aid


With the above-mentioned vehicle, the reversing warning system (parking aid) may suddenly fail. The error message "System not available" appears in the display. And often then the "start/stop" function also no longer works.

In this case, the cause is not necessarily to be found with the software or with the electronic components. The first thing to do is to check the fuses in the fuse box located in the driver's footwell (Fig. 1).

In most such cases, the fuse for the electrically heated wiper washer nozzles is defective (Fig. 2). The cause of this is a short circuit in the heating element of the wiper washer nozzle with the result that not only the fuse but also the nozzles must be replaced.

After replacing these components, functioning of both the parking aid and of the "start/stop" feature is restored.

Where appropriate, this information can also apply to other Volkswagen models.

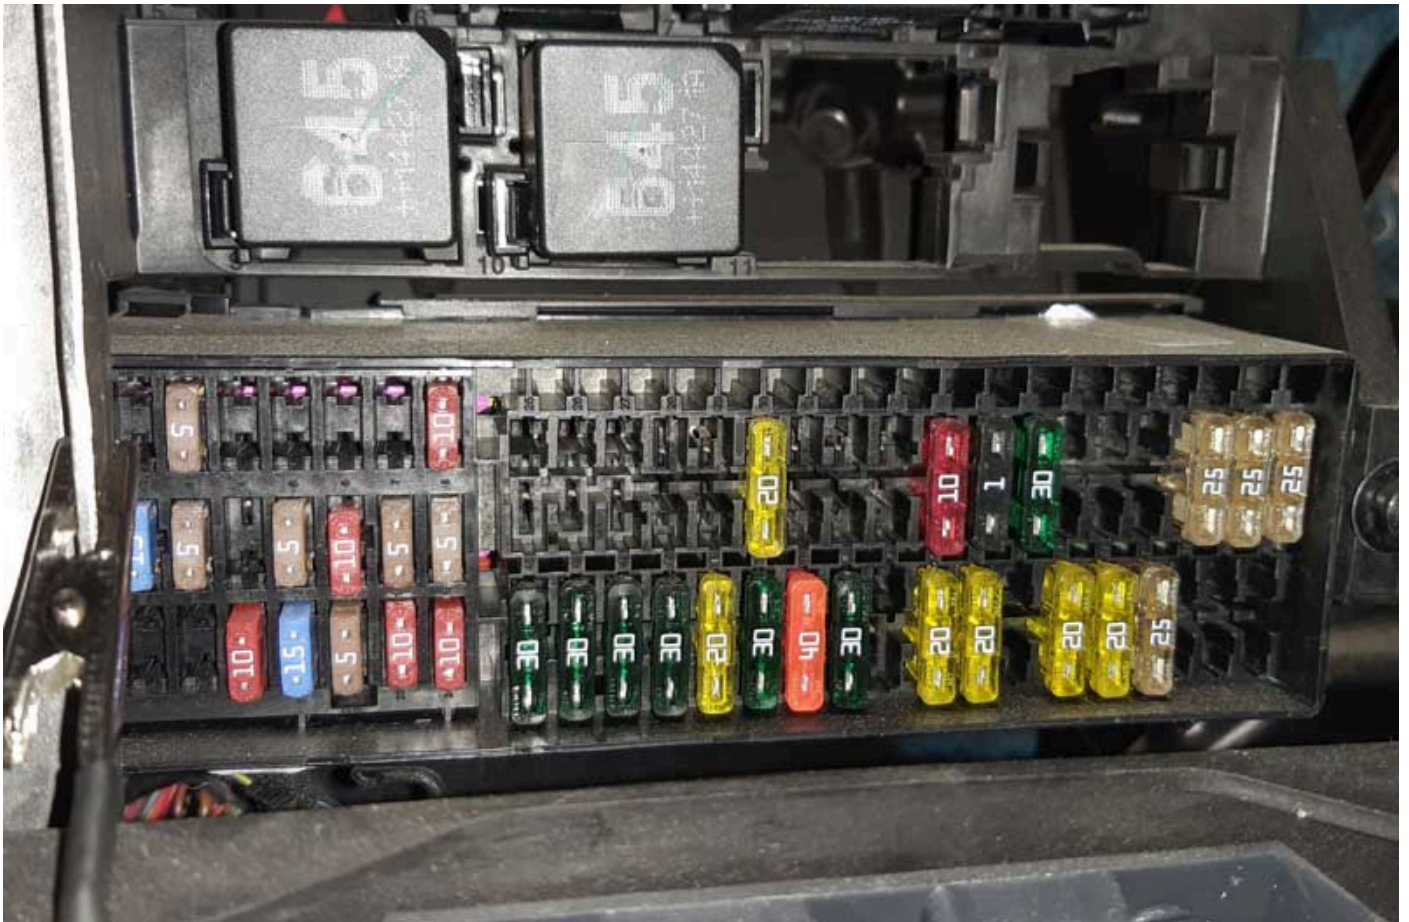

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.