



VW T5 - coolant thermostat

Data sheet

Manufacturer	Volkswagen
Vehicle model	Transporter T5
Engine	1.9 TDI
Year of manufacture	2006 - 2009
Symptoms	Coolant thermostat

Important safety note

Operating temperature is not reached, thermostat and coolant flange

On the vehicle mentioned above, it can happen that the operating temperature is not reached. Sometimes the temperature display in the instrument cluster shows a "cold engine".

The cause can often be found in the area of the thermostat, which does not close properly.


The thermostat is located on the engine block, behind the alternator.

After removing the coolant flange, the thermostat can then also be removed together with the sealing ring.

Before installing the new thermostat, the coolant flange should be inspected.

Part of the plastic guide (installation aid) often breaks off here.

It is then advisable to replace the flange.

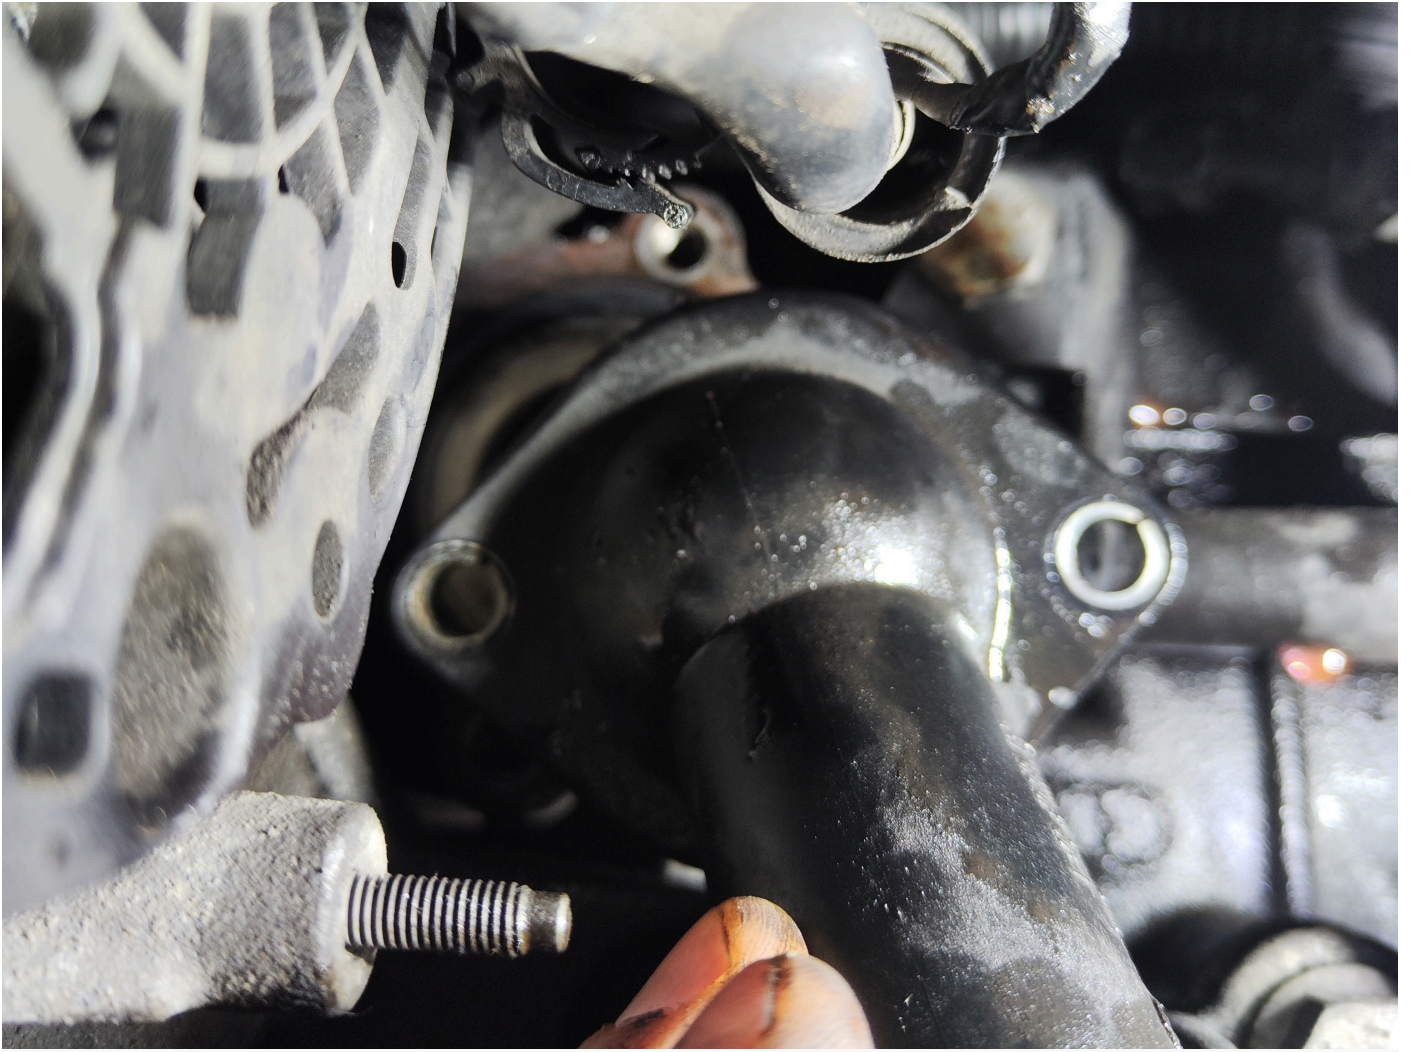

Coolant flange T5



Plastic guide for T5 coolant flange

ⓘ Important safety note

The following technical information and practical tips have been compiled by HELLA in order to provide professional support to vehicle workshops in their day-to-day work. The information provided on this website is intended for suitably qualified personnel only.

ⓘ IMPORTANT

Please always follow the repair instructions from the vehicle manufacturer when carrying out such work!



Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.